

Home Report

shepherd.co.uk



All Angles Covered

Residential | Commercial | Property & Construction





Contents

- 1. Scottish Single Survey
- 2. Energy Performance Certificate
- 3. Property Questionnaire



Scottish
Single Survey



survey report on:

Property address	43 Broompark Drive Glasgow G31 2JB
Customer	Church of Scotland
Customer address	43 Broompark Drive Glasgow G31 2JB
Prepared by	Shepherd Chartered Surveyors
Date of inspection	25/07/2024



www.shepherd.co.uk

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by marking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller:
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether
 or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report².

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;

- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments

being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 <u>Category 3:</u> Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 <u>Category 2:</u> Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use

communal grounds, parking areas, and other facilities;

- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	The subject comprises a two storey mid terraced villa.
Accommodation	GROUND FLOOR:- Entrance Vestibule leading to Entrance Hallway, Living Room, Internal Wet Room with W.C., W.C./Cloakroom, Dinning Room, Breakfasting Kitchen, Rear Cloakroom/W.C. and Bedroom Five. FIRST FLOOR:- Upper Landing, Four Bedrooms & Primary Internal Bathroom (with WC).
Gross internal floor area (m²)	The gross internal floor area is 181m² or thereby.
Neighbourhood and location	The subjects are located within the Dennistoun district of Glasgow where surrounding properties are of similar age and character. Adequate local shopping, educational and transport facilities are available. The subjects are situated within the Dennistoun Conservation Area and are understood to be a B Listed building.
Age	Believed to be constructed circa 1890.
Weather	Dry and overcast.
Chimney stacks	Visually inspected with the aid of binoculars where appropriate. Chimney stacks pertaining to the property were seen to be formed in a combination of solid stone and rendered brick construction.

Roofing including roof space Rainwater fittings	Sloping roofs were visually inspected with the aid of binoculars where appropriate. The roof was seen to be of multi pitched design overlaid with a slate finish. No access to the main roof void was available due to this being outwith the scope of our inspection. Visually inspected with the aid of binoculars where appropriate.
	The rainwater goods serving the subjects were seen to be formed in a combination of PVC and cast iron materials.
Main walls	Visually inspected with the aid of binoculars where appropriate. Foundations and concealed parts were not exposed or inspected. The main walls appear to be a combination of solid stone construction and solid brick overlaid with a render finish.
Windows, external doors and joinery	Internal and external doors were opened and closed
	Where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. Windows within the property are predominantly of uPVC construction containing double glazed units. There is a further timber framed double glazed unit located within the rear bedroom. Access to the property is by way of double leaf timber storm doors leading to a timber glazed internal door. The rear garden grounds are accessed by way of a timber door from the kitchen.
External decorations	Visually inspected.
	External decorations incorporate paint and stained finishes.
Conservatories / porches	Not applicable.
Communal areas	There is a communal access lane to the rear of the property.

Garages and permanent outbuildings Visually inspected. There is a single car garage to the rear. This is understood to be of brick/block construction under a pitched felt roof. Access to the garage is via up and over vehicular doors to the front and rear. There is a further garden store located within the rear garden plot (previous wash-house). This is of brick construction overlaid with a pitched and hipped slate roof. Only a limited inspection of both garage and store cupboards were available due to stored items. There is a tank located within the external store which appears to be in situ but we assume is no longer in use. It would be prudent to have this removed. Outside areas and boundaries Visually inspected. There are private garden grounds to the front and rear of the property. Boundaries are predominantly formed in masonry. There is an access lane located at the rear of the plot. Confirmation of the separation of land can be found via the title deeds. Ceilings Visually inspected from floor level. Ceilings within the property would appear to be of timber lath and plaster and plasterboard materials. Internal walls Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate. Internal walls appear to be of timber lath and plaster, plaster and plasterboard design. Floors including sub floors Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted. Flooring within the property is believed to be a combination of suspended timber and solid concrete construction. Fitted floorcoverings were noted throughout which restricted the scope of our inspection. No access was gained to the sub-floor.

Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved.
	Kitchen units were visually inspected excluding appliances.
	Internal joinery incorporates timber skirtings and door facings together with internal pass doors of timber construction.
	The kitchen facility incorporates fitted units providing adequate storage.
Chimney breasts and fireplaces	Visually inspected.
	No testing of the flues or fittings was carried out.
	All original chimney breasts/fireplaces appear to have been blocked over/removed and are no longer in use.
	Several decorative electric fires were noted throughout the property. No tests were taken of these systems.
Internal decorations	Visually inspected.
internal decorations	
	Internal decorations incorporate paint, papered, tiled and panel finishes.
Cellars	Visually inspected where there was a safe and purpose- built access.
	There are several external storage cellars pertaining to the property. Only a limited inspection of some cellars was possible due to restricted access. These are believed for basic storage purposes only.
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.
	Electricity is from the mains supply.
	The electrical switchgear is located within the entrance hallway.

Gas

Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.

Gas is from the mains supply.

The gas meter is located externally from the property.

Water, plumbing, bathroom fittings

Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.

No tests whatsoever were carried out to the system or appliances.

Water is assumed to be from the mains.

Water piping, where visible, was run in copper and PVC.

We would highlight that it is possible for a property of this age to have lead pipework still in use but concealed from view. A suitably qualified contractor can give further advice in this regard.

The ground floor bathroom incorporates a wet shower room, Wc & wash hand basin. The upper bathroom consists of a bath with shower, Wc & wash hand basin. Due to the internal formation of the bathrooms it is assumed that all ventilation has been correctly installed and maintained, any documentation for this, where available, should be obtained and confirmed.

There are two further Wc facilities located on ground floor level.

Heating and hot water

Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.

No tests whatsoever were carried out to the system or appliances.

Domestic heating and hot water are provided by way of a gas fired boiler wall mounted within the kitchen which vents by way of a flue to the rear elevation of the property.

Drainage	Drainage covers etc. were not lifted.
	Neither drains nor drainage systems were tested.
	All foul and surface water drainage is assumed to be to the main public sewer. The system was not tested.

Fire, smoke and burglar alarms Visually inspected. No tests whatsoever were carried out to the system or appliances. Some smoke equipment was noted within the property. The system was not tested. All Scottish homes require a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also needs to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbonfuelled appliance such as a boiler, open fire or wood burner, a carbon monoxide detector is also required. We have not assessed or tested any existing equipment and it is the purchasers responsibility to confirm that the property will comply with these standards following a change of ownership.

Any additional limits to inspection

An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor.

The property had fitted floor coverings, therefore no detailed inspection was possible of the floors and accordingly, no comment can be made on their condition. No access was available beneath sanitary or kitchen fittings.

Windows and external doors were not all fully opened or tested.

No access was available to any sub-floor areas.

Full and safe access was not available to the roof void area due to this being outwith the scope of our inspection.


Internal panelling and plasterboard prevented accurate damp readings being taken in some areas.

No inspection has been possible to flooring timbers beneath any sanitary fitting, kitchen appliances or other wet areas was possible. Timbers are assumed to be in a satisfactory condition.

The cold water rising main was not fully inspectable.

At the time of inspection both the garage and external store cupboards were noted contain stored items and hence severely restricted the scope of our inspection.

Sectional Diagram showing elements of a typical house

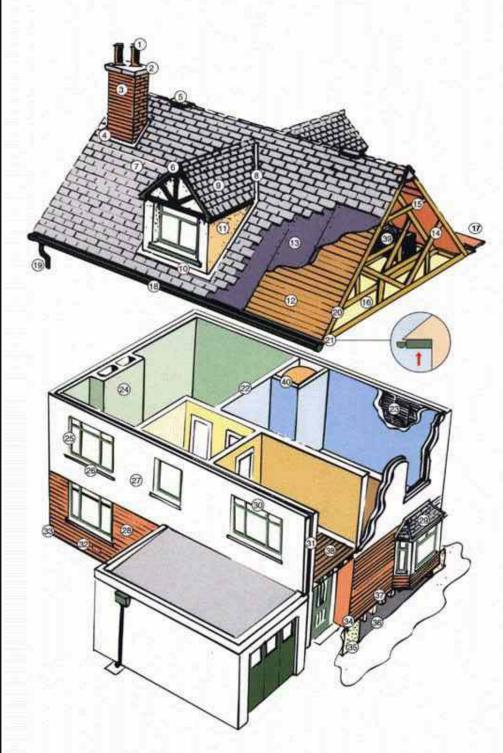

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

- 1) Chimney pots
- 2) Coping stone
- 3) Chimney head
- (4) Flashing
- 5) Ridge ventilation
- (6) Ridge board
- (7) Slates / tiles
- 8 Valley guttering
- 9 Dormer projection
- 10) Dormer flashing
- 11) Dormer cheeks
- (12) Sarking
- 13) Roof felt
- (14) Trusses
- (15) Collar
- 16) Insulation
- (17) Parapet gutter
- 18) Eaves guttering
- (19) Rainwater downpipe
- 20) Verge boards/skews
- Soffit boards
- 22) Partition wall
- 23) Lath / plaster
- (24) Chimney breast
- 25) Window pointing
- 26) Window sills
- 27) Rendering
- (28) Brickwork / pointing
- 29 Bay window projection
- (30) Lintels
- (31) Cavity walls / wall ties
- 32) Subfloor ventilator
- (33) Damp proof course
- 34) Base course
- (35) Foundations
- 36) Solum
- 37) Floor joists
- 38) Floorboards
- 9) Water tank
- 40) Hot water tank

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
	Repairs or replacement requiring future attention, but estimates are still advised.	

Structural movement	
Repair category	2
Notes	Evidence of settlement/movement was observed in the form of various forms of cracking throughout the property. It is not possible to say that further significant movement will not occur. While further movement would seem unlikely, the advice of a structural engineer should be obtained prior to purchase.

Dampness, rot and infestation	
Repair category	2
Notes	Above average damp readings were obtained to various areas within the property. A precautionary check of the entire property should be carried out by a reputable timber and damp specialist prior to purchase.

Chimney stacks	
Repair category	2
Notes	Weathered was noted to the chimney stacks. Future repairs may be required.

Roofing including roof space	
Repair category	2
Notes	A number of chipped and lifted roof slates were visible. Roof coverings are of an age and style where a degree of regular ongoing maintenance should be anticipated. Damp staining was evident within the subjects indicative of water ingress.

Rainwater fittings	
Repair category	2
Notes	Vegetation was noted within the guttering requiring clearing. Gutters require to be cleared of vegetation and debris in the short term and on a regular basis. Sections of the rainwater goods are of an older style and have suffered
	corrosion. Maintenance is required and gutters/downpipes checked during heavy rainfall.

Main walls	
Repair category	2
Notes	Weathering and cracking was noted to the main walls and future repair/ ongoing maintenance should be anticipated.

Windows, external doors and joinery	
Repair category	2
Notes	Windows are of an age and style where a degree of ongoing maintenance should be anticipated to sealed units and opening mechanisms.
	Weathering was noted to the front entrance door and future maintenance/repair should be anticipated.

External decorations	
Repair category	1
Notes	Paint finished and decorated external surfaces will require redecoration on a regular basis.

Conservatories/porches	
Repair category	N/A
Notes	Not applicable.

Communal areas	
Repair category	1
Notes	Communal access only, these areas should be regularly maintained.

Garages and permanent outbuildings	
Repair category	3
Notes	Weathered masonry was noted to both the garage and the external store and repairs are required.
	The roof pertaining to the garage appears to have past its lifespan and replacement is required. Furthermore, the roof pertaining to the store is also aged and as such future replacement/repair should be anticipated.
	The up and over vehicular doors pertaining to the garage do not appear to be functioning and replacement/repair should be anticipated.

Outside areas and boundaries	
Repair category	2
Notes	Boundary walls and fences should be regularly checked and maintained as necessary.
	Weathering was noted to the boundary walls and future repair/maintenance should be envisaged.

Ceilings	
Repair category	2
Notes	Evidence of plaster cracking/loose plaster work was noted requiring repair.
	Staining was noted to several ceilings within the property and future monitoring/repair should be anticipated.

Internal walls	
Repair category	2
Notes	Cracked/bossed wall plaster was noted and repairs may be required at the time of disturbance or redecoration. Scuffs and blemishes were noted throughout the property and cosmetic work/repair should be anticipated.

Floors including sub-floors	
Repair category	2
Notes	Due to fitted carpets and floor coverings no detailed inspection of floors was possible and accordingly no comment can be made on their condition. Loose and uneven flooring was noted throughout the property and ongoing maintenance and care should be anticipated.

Internal joinery and kitchen fittings	
Repair category	2
Notes	Internal joinery is generally serviceable however some wear and tear items were noted to kitchen fittings/internal doors/facings etc. and future maintenance or upgrading should be anticipated. The kitchen is consistent with use and future upgrading may prove beneficial.

Chimney breasts and fireplaces	
Repair category	1
Notes	All flue linings should be checked, repaired if necessary and swept prior to fires/appliances being reused.
	A number of the fire places have been removed/covered over. It is assumed that the chimneys are adequately vented with the chimneys capped. Ventilators should be fitted to prevent the build-up of dampness within the chimney flue.
	As previously mentioned no tests were taken to decorative electric fires throughout the property. It would be prudent to have these checked by a suitably qualified contractor prior to purchase.

Internal decorations	
Repair category	1
Notes	The internal decoration will require to be upgraded dependant on individual taste.

Cellars	
Repair category	1
Notes	Cellars appear to be for basic storage purposes only. As previously stated, our inspection was limited due to stored items.

Electricity	
Repair category	2
Notes	Aspects of the electrical installation are dated and the system should be checked as a precaution by a registered electrician and upgraded if necessary The Institution of Engineering Technology recommends that inspections and testings are undertaken at least every five years and on a change of occupancy. It should be appreciated that only the most recently constructed or re-wired properties will have installations which fully comply with IET regulations.

Gas	
Repair category	1
Notes	In the interests of safety and in light of recent regulations it would be prudent to have all gas appliances checked by a Gas Safe registered contractor.

Water, plumbing and bathroom fittings	
Repair category	2
Notes	Sanitary fittings appear serviceable however surround seals, tiling and finishes should be checked and maintained watertight. We were unable to view concealed areas below sanitary fittings and cannot confirm they are free from damp or other defects.
	The cold water rising main was not fully inspectable.
	Due to the internal nature of several bathrooms the ventilation system for each apartment should be checked and maintained to reduce the risk of future defect.
	Staining was noted within the first floor bathroom. Although this tested dry during our inspection, future and ongoing monitoring should be anticipated.
	Bathroom and Wc apartments are consistent with use although future upgrading may prove beneficial.

Heating and hot water		
Repair category	2	
Notes	It is assumed that the central heating system has been properly installed, updated and maintained to meet with all current regulations and standards with particular regard to fluing and ventilation requirements. Service records should be obtained and checked. In the absence of service documentation further advice should be obtained from a qualified heating engineer to ascertain the condition, efficiency, and life expectancy of the system. Radiator units within the property are of mixed vintage, some of which now appear to have past their economic lifespan. Future replacement should be envisaged.	

Drainage	
Repair category	1
Notes	All foul and surface water drainage is assumed to be to the main public sewer. The system was not tested.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	2
Dampness, rot and infestation	2
Chimney stacks	2
Roofing including roof space	2
Rainwater fittings	2
Main walls	2
Windows, external doors and joinery	2
External decorations	1
Conservatories/porches	N/A
Communal areas	1
Garages and permanent outbuildings	3
Outside areas and boundaries	2
Ceilings	2
Internal walls	2
Floors including sub-floors	2
Internal joinery and kitchen fittings	2
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	1
Electricity	2
Gas	1
Water, plumbing and bathroom fittings	2
Heating and hot water	2
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Wherea lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?		Ground & First		
2. Are there three steps or fewer to a main entrance door of the property?	Yes		No	X
3. Is there a lift to the main entrance door of the property?			No	X
4. Are all door openings greater than 750mm?			No	X
5. Is there a toilet on the same level as the living room and kitchen?	Yes	X	No	
6. Is there a toilet on the same level as a bedroom?	Yes	X	No	
7. Are all rooms on the same level with no internal steps or stairs?			No	X
8. Is there unrestricted parking within 25 metres of an entrance door to the building?		X	No	

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

It is assumed that there are no statutory, town planning, road proposals or environmental matters which are likely to have an adverse effect on the property.

The road and footpath adjoining the site are made up and are assumed to be adopted by the Local Authority.

It is assumed that all alterations, additions and/or extensions to the property have received all necessary Town Planning (Planning Permission) and Building Authority (Building Warrants and Completion Certificate) approvals and that documentation for such is available, paying particular attention to the current layout of the property.

Where defects or repairs have been identified within this report it is recommended that, prior to entering into any legally binding sale or purchase contract, further specialist's or contractor's advice and estimates should be obtained, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property.

The property is a 'B' listed building and is located in a conservation area and as such the cost of repair or reinstatement works are likely to be higher than normal. Any works considered necessary will require to be carried out in consultation with the Local Authority Planning Department and Historic Environment Scotland.

The property is situated in an area of past mining activity. A mining report should be obtained from the Coal Authority to provide information as to historic and future mining activity and whether the property has been the subject of any compensation claims and to confirm that the property is not adversely affected.

Estimated reinstatement cost for insurance purposes

For Reinstatement Cost Assessment purposes, it is recommended that the subjects be insured for a sum of not less than £910,000 (NINE HUNDRED AND TEN THOUSAND POUNDS STERLING).

This figure is the estimate of the cost of rebuilding the premises and bears no direct relationship to current market value.

Valuation and market comments

Having considered matters, taking account of our general observations on site, we are of the opinion that the Market Value of the subjects in their present condition and with the benefit of vacant possession may be fairly stated in the sum of £410,000 (FOUR HUNDRED AND TEN THOUSAND POUNDS STERLING).

Signed	Antony Burns Electronically signed :- 20/08/2024 10:16
Report author	Antony Burns
Company name	J & E Shepherd Chartered Surveyors
Address	31 Byres Road Glasgow G11 5RD
Date of report	25/07/2024



www.shepherd.co.uk

Property Address	
Address Seller's Name Date of Inspection	43 Broompark Drive, Glasgow, G31 2JB Church of Scotland 25/07/2024
Property Details	
Property Type X House Purpose built flat	Bungalow Purpose built maisonette Converted maisonette Converted flat Tenement flat Flat over non-residential use Other (specify in General Remarks)
Property Style Detached Back to back	Semi detached X Mid terrace ☐ End terrace High rise block ☐ Low rise block ☐ Other (specify in General Remarks)
Does the surveyor believe that the military, police? Flats/Maisonettes only Floor(s) on what Approximate Year of Construction	property was built for the public sector, e. g. local authority, No. of floors in block No. of units in block 1890 No. of units in block
Tenure	
X Absolute Ownership	Other
Accommodation	
Number of Rooms 2 Living room 2 Bathroom(s	
Gross Floor Area (excluding garage	es and outbuildings) 181 m² (Internal) 207 m² (External)
Residential Element (greater than 4	0%) X Yes No
Garage / Parking / Outbuildings	
X Single garage Double gar	rage Parking space No garage / garage space / parking space
Available on site?	No
Permanent outbuildings:	
Detached storage cellar with further externation	al stores.

Construction
Walls Brick X Stone Concrete Timber frame Other (specify in General Remarks) Roof Tile X Slate Asphalt Felt Other (specify in General Remarks)
Special Risks
Has the property suffered structural movement?
If Yes, is this recent or progressive?
Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in \square Yes \boxtimes No the immediate vicinity?
If Yes to any of the above, provide details in General Remarks.
Service Connections
Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in General Remarks
Drainage X Mains Private None Water X Mains Private None
Electricity X Mains Private None Gas X Mains Private None Central Heating X Yes Partial None
Brief description of Central Heating and any non mains services:
Gas fired boiler to radiators.
Site
Apparent legal issues to be verified by the conveyancer. Please provide a brief description in General Remarks.
Rights of way X Shared drives / access Garage or other amenities on separate site Shared service connections
☐ Ill-defined boundaries ☐ Agricultural land included with property ☐ Other (specify in General Remarks)
Location
Residential suburb X Residential within town / city Mixed residential / commercial Shared service connections
Commuter village Remote village Isolated rural property Other (specify in General Remarks)
Planning Issues
Has the property been extended / converted / altered? X Yes No If Yes provide details in General Remarks.
Roads
X Made up road Unmade road Partly completed new road Pedestrian access only Adopted Unadopted

General Remarks

The subject comprises a two storey mid terraced villa with additional maids quarters.

The subjects are located within the Dennistoun district of Glasgow where surrounding properties are of similar age and character.

Adequate local shopping, educational and transport facilities are available.

The subjects are situated within the Dennistoun Conservation Area and are understood to be a B Listed building.

Evidence of settlement/movement was observed in the form of various forms of cracking throughout the property. It is not possible to say that further significant movement will not occur. While further movement would seem unlikely, the advice of a structural engineer should be obtained prior to purchase.

It is assumed that all alterations, additions and/or extensions to the property have received all necessary Town Planning (Planning Permission) and Building Authority (Building Warrants and Completion Certificate) approvals and that documentation for such is available, paying particular attention to the current layout of the property.

Above average damp readings were obtained to various areas within the property. A precautionary check of the entire property should be carried out by a reputable timber and damp specialist prior to purchase.

The property is a 'B' listed building and is located in a conservation area and as such the cost of repair or reinstatement works are likely to be higher than normal. Any works considered necessary will require to be carried out in consultation with the Local Authority Planning Department and Historic Environment Scotland.

The property is situated in an area of past mining activity. A mining report should be obtained from the Coal Authority to provide information as to historic and future mining activity and whether the property has been the subject of any compensation claims and to confirm that the property is not adversely affected.

At the time of inspection the property was found to be in a condition generally consistent with its age and type of construction but some works of maintenance and repair are required. Elements of the property are aging and likely to require attention.

Essential Repairs	
Estimated cost of essential repairs	TBC
Retention recommended?	Yes X No
Retention amount	
Comment on Mortgageabilit	у
The property forms suitable security for	mortgage purposes subject to the specific lending criteria of any mortgage provider.

Valuation £ 410,000 Market value in present condition £ 410,000 Market value on completion of essential repairs £ □ Insurance reinstatement value £ 910,000 (to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT) □ Yes X No

Declaration

Signed Antony Burns

Electronically signed :- 20/08/2024 10:16

Surveyor's name Antony Burns

Professional qualifications MRICS

Company name J & E Shepherd Chartered Surveyors Address 31 Byres Road, Glasgow, G11 5RD

Telephone 0141 353 2080

Email Address glasgow@shepherd.co.uk

Date of Inspection 25/07/2024



Energy Performance Certificate



Energy Performance Certificate (EPC)

Dwellings

Scotland

43 BROOMPARK DRIVE, GLASGOW, G31 2JB

Dwelling type:Mid-terrace houseDate of assessment:25 July 2024Date of certificate:30 July 2024Total floor area:181 m²

Primary Energy Indicator: 296 kWh/m²/year

Reference number: 0110-2555-0230-2524-8455 **Type of assessment:** RdSAP, existing dwelling

Approved Organisation: Elmhurst

Main heating and fuel: Boiler and radiators, mains


gas

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	your home for 3 years* £10,263	
Over 3 years you could save*	£2,016	report for more information

^{*} based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

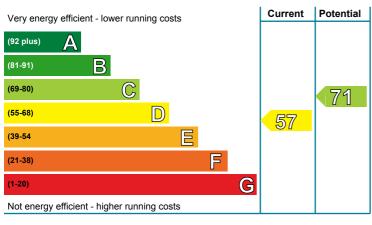


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (57)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

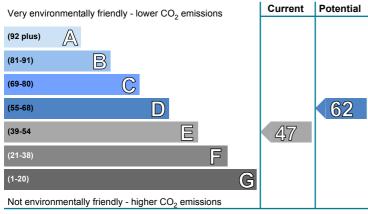

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO_2) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band E (47)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Internal or external wall insulation	£4,000 - £14,000	£1170.00
2 Floor insulation (suspended floor)	£800 - £1,200	£414.00
3 Heating controls (room thermostat)	£350 - £450	£438.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone or limestone, as built, no insulation (assumed)	***	***
	Solid brick, as built, no insulation (assumed)	****	***
Roof	Pitched, no insulation (assumed)	****	\star $\dot{\sim}$ $\dot{\sim}$ $\dot{\sim}$
Floor	Suspended, no insulation (assumed)	_	_
Windows	Mostly double glazing	★★★☆☆	***
Main heating	Boiler and radiators, mains gas	****	★★★★ ☆
Main heating controls	Programmer, TRVs and bypass	★★★☆☆	***
Secondary heating	None	_	_
Hot water	From main system	****	★★★ ☆
Lighting	Low energy lighting in all fixed outlets	****	****

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 52 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 9.5 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 2.9 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£9,147 over 3 years	£7,128 over 3 years	
Hot water	£618 over 3 years	£621 over 3 years	You could
Lighting	£498 over 3 years	£498 over 3 years	save £2,016
Totals	£10,263	£8,247	over 3 years


These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures		Indicative cost	Typical saving per year	Rating after improvement	
				Energy	Environment
1	Internal or external wall insulation	£4,000 - £14,000	£390	D 62	E 52
2	Floor insulation (suspended floor)	£800 - £1,200	£138	D 64	E 54
3	Upgrade heating controls	£350 - £450	£146	D 65	D 56
4	Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£468	C 71	D 62

Choosing the right improvement package

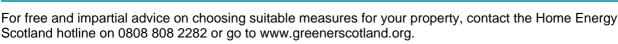



About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Internal or external wall insulation

Internal or external wall insulation involves adding a layer of insulation to either the inside or the outside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. External solid wall insulation is the application of an insulant and a weather-protective finish to the outside of the wall. This may improve the look of the home, particularly where existing brickwork or rendering is poor, and will provide long-lasting weather protection. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). It should be noted that a building warrant is required for the installation of external wall insulation. Planning permission may also be required and that building regulations apply to external insulation so it is best to check with your local authority on both issues.

2 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

3 Heating controls (room thermostat)

The heating system should have a room thermostat to enable the boiler to switch off when no heat is required. A competent heating engineer should be asked to do this work. Insist that the thermostat switches off the boiler as well as the pump and that the thermostatic radiator valve is removed from any radiator in the same room as the thermostat. Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

4 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit https://energysavingtrust.org.uk/energy-at-home for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	32,089	(8,422)	N/A	(4,928)
Water heating (kWh per year)	2,337			

Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:

Assessor membership number:

Company name/trading name:

Address:

Mr. Antony Burns

EES/023012

J & E Shepherd

13 Albert Square

Dundee

Dundee DD1 1XA

Phone number: 01382 200454
Email address: dundee@shepherd.co.uk

Related party disclosure:

No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greeners cotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT





Property Questionnaire



Property Address	43 Broompark Drive Glasgow G31 2JB
Seller(s)	The Church of Scotland General Trustees
Completion date of Property Questionnaire	18/07/2024

Note for sellers

- Please complete this form carefully. It is important your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell you solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Length of Ownership	
	How long have you owned t	he property? Approximately 70 years.
2.	Council Tax	
	Which Council Tax band is y	your property in?
	□A □B □C	□D ⊠E □F □G □H
3.	Parking	
	What are the arrangements	for parking at your property?
	(Please tick all that apply)	
	Garage	
	Allocated parking space	
	Driveway	
	On street	
	Resident Permit	
	Metered parking	
	Shared parking	
	Other (please specify)	

4.	Conservation area	
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	Yes
5.	Listed buildings	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	Yes
6.	Alterations/Additions/Extensions	
a.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example provision of an extra bath/shower room, toilet or bedroom)? If you have answered yes, please describe below the changes which you have made:	Yes
	Wet room on ground floor. Toilet with wash hand basin on ground floor.	
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work? If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them.	N/A
b.	Have you had replacement windows, doors, patio doors or double-glazing installed in your property? If you have answered yes, please answer the three questions below:	Yes
	(i) Were the replacements the same shape and type as the ones you replaced?	No
	(ii) Did this work involve any changes to the window or door openings?	No
	(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):	
	Pvc windows throughout. Approximately 2009.	

7.	Central heating	
	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom).	Yes
	If you have answered yes or partial – what kind of central heating is there?	
	Gas fired central heating.	
	(examples: gas-fired, solid fuel, electric storage heating, gas-warm air).	
	If you have answered yes, please answer the three questions below:	
	(i) When was your central heating system or partial central heating system installed?	
	Approximately 2009	
	(ii) Do you have a maintenance contract for the central heating system?	Yes
	If you have answered yes, please give details of the company with which you have a maintenance contract:	
	Scottish Gas	
	(iii) When was your maintenance agreement last renewed? (Please provide the month and year).	
	March 2024	
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate, which is less than 10 years old?	Yes
9.	Issues that may have affected your property	
a.	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	Yes
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	No

b.	Are you aware of the existence of asbestos in your property?			No
	If you have answered yes, please give d			
10.	Services			
a.	Please tick which services are connected supplier:	d to your prope	rty and give details of the	
	Services	Connected	Supplier	
	Gas or liquid petroleum gas	\boxtimes	Octopus	
	Water mains or private water supply	\boxtimes	Scottish Water	
	Electricity			
	Mains drainage			
	Telephone	\boxtimes	ВТ	
	Cable TV or satellite			
	Broadband		BT	
b.	Is there a septic tank system at your p	property?		No
	If you have answered yes, please answe	er the two ques	tions below:	
	(i) Do you have appropriate consents for	Please select		
	(ii) Do you have a maintenance contract	Please select		
	If you have answered yes, please give d have a maintenance contract:			

11.	Responsibilities for shared or common areas	
a.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? If you have answered yes, please give details: Residents' Garden Area.	Yes
b.	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? If you have answered yes, please give details:	No
C.	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	Yes
d.	Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries? If you have answered yes, please give details:	No
e.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries? If you have answered yes, please give details:	No

f.	As far as you are aware, is there a public right of way across any part of your property (public right of way is a way over privately-owned)? If you have answered yes, please give details:	No
12.	Charges associated with your property	
a.	Is there a factor or property manager for your property? If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	No
b.	Is there a common buildings insurance policy? If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?	No Please select
c.	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund. Approximately £50 annually for upkeep of common garden area.	

13.	Specialist works	
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property: Damp in back bedroom on ground floor 15 to 20 years ago.	Yes
b.	As far as you were aware, has any preventative work for dry rot, wet rot, or damp, ever been carried out to your property? If you have answered yes, please give details:	Yes
	15 to 20 years ago.	
c.	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?	No
	If you have answered yes these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. Guarantees are held by:	
	I think these will be with General Trustees.	

14.	Guarante	ees	
a.	Are there		
	(i)	Electrical work	Don't Know
	(ii)	Roofing	Don't Know
	(iii)	Central heating	Don't Know
	(iv)	National House Building Council (NHBC)	Don't Know
	(v)	Damp course	Don't Know
	(vi)	Any other work or installations (for example, cavity wall insulation, underpinning, indemnity policy)	Don't Know
b.		ve answered yes or 'with title deeds', please give details of the work or one to which the guarantee(s) relate(s):	
c.		any outstanding claims under any of the guarantees listed above? ve answered yes, please give details:	No
15.	Boundar	ies	
	last 10 ye	you are aware, has any boundary of your property been moved in the ears? ye answered yes, please give details:	No

16.	Notices that affect your property	
	In the past three years have you ever received a notice:	
a.	advising that the owner of a neighbouring property has made a planning application?	No
b.	that affects your property in some other way?	No
c.	that requires you to do any maintenance, repairs or improvements to your property?	No
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.	

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the	information in this form is	true and correct to the	e best of my/our knowle	dge and belief.
Signature(s):				
Date:		_		

shepherd.co.uk





Home Report

Valuation Report

Executory Valuation

Tax Valuations

Separation Valuation

Private Sale Valuation

New Build & Plot Valuation

Insurance Reinstatement Valuation

Portfolio Valuation

Rental Valuation

Drive By & Desktop Valuation

Energy Performance Certificate (EPC)

Level Two Survey & Valuation Report

Level Two Condition Report

Expert Witness Report





Commercial Valuation

Commercial Agency

Acquisitions Consultancy

Commercial Lease Advisory

Rent Reviews

Asset Management

Development Appraisals & Consultancy

Auctions

Property Management

Professional Services

Licensed Trade & Leisure

Expert Witness Report

Rating

Property Investment

Public Sector



PROPERTY & CONSTRUCTION CONSULTANTS



Quantity Surveying

Building Surveying

Project Management

Dispute Resolution Support Services

Principal Designer

Clerk of Works

Commercial EPC

Health & Safety Management

Employer's Agent

Energy Consultancy

Housing Partnerships

Housing Consultancy

Development Monitoring

Mediation Services

Aberdeen △▲△ 01224 202800

Ayr △ △ 01292 267987

Bearsden △▲ 0141 611 1500

Belfast ▲ 02890 912975

Birmingham **▲** 0121 270 2266

Coatbridge △▲ 01236 436561

Cumbernauld △ △ 01236 780000

Dalkeith △ △ 0131 663 2780

Dumbarton △ ▲ 01389 731682

Dumfries △▲△ 01387 264333

Dundee

△▲ 01382 200454 △ 01382 220699

Dunfermline △▲ 01383 722337 △ 01383 731841

East Kilbride △▲ 01355 248535 **Edinburgh**

△ 0131 557 9300

Elain

△ ▲ 01343 553939

Falkirk

△△ 01324 635 999

Fraserburgh

△ ▲ 01346 517456

Galashiels △△ 01896 750150

Glasgow △△△ 0141 331 2807

Glasgow South △ ▲ 0141 649 8020 **Glasgow West End** △ ▲ 0141 353 2080

Greenock △▲01475 730717

Hamilton △▲01698 897548

Inverness △△△01463 712239

Kilmarnock △△01563 520318

Kirkcaldy △ △ 01592 205442

Leeds △ 0113 322 5069

Livingston △ ▲ 01506 416777

London ▲△ 02033 761 236

Montrose △ △ 01674 676768

Motherwell △△ 01698 252229

Musselburgh △ △ 0131 653 3456

Oban △▲ 01631 707 800

Paisley △△ 0141 889 8334

Perth △ △ 01738 638188

△ 01738 631631

Peterhead △△ 01779 470766

St Andrews △△ 01334 477773 △ 01334 476469

Saltcoats △ △ 01294 464228

Stirling △△ 01786 450438 △ 01786 474476