



# Home Report

[shepherd.co.uk](http://shepherd.co.uk)



**SHEPHERD**

**CHARTERED SURVEYORS**

All Angles Covered

Residential | Commercial | Property & Construction



## Contents

---

1. Scottish Single Survey
  2. Energy Performance Certificate
  3. Property Questionnaire
-



# Scottish Single Survey



# Single Survey

survey report on:

<b>Property address</b>	92 Grampian Gardens Arbroath DD11 4AQ
<b>Customer</b>	Church of Scotland
<b>Customer address</b>	92 Grampian Gardens Arbroath DD11 4AQ
<b>Prepared by</b>	Shepherd Chartered Surveyors
<b>Date of inspection</b>	10/03/2025



[www.shepherd.co.uk](http://www.shepherd.co.uk)

## PART 1 - GENERAL

### 1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property<sup>1</sup>.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by marking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

### 1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

<sup>1</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

## 1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

## 1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

## 1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report<sup>2</sup>.

## 1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless

---

<sup>2</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

they assign the same to any other party in writing.

## 1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

## 1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

## 1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

## 1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;

- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

## PART 2 - DESCRIPTION OF THE REPORT

### 2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

### 2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

### 2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments



being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

**WARNING:** If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

## 2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

## 2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

## 2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

## 2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion.* In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use

# Terms and Conditions

communal grounds, parking areas, and other facilities;

- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" *is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form* unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

## 1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

<b>Description</b>	The subjects comprise an extended detached chalet style villa.
<b>Accommodation</b>	Ground Floor: Extended Entrance Vestibule into Home Office/Study, Lounge, Dining Room, Kitchen with extended Utility Space, Two Bedrooms and Shower Room.  Attic Floor: Main Bedroom with En-Suite Shower Room, Two additional Bedrooms and Bathroom.
<b>Gross internal floor area (m<sup>2</sup>)</b>	The gross internal floor area extends to approximately 197m <sup>2</sup> .
<b>Neighbourhood and location</b>	The property forms part of a private residential development of largely similar style properties, which lies to the north-east of central Arbroath where a wide range of local amenities and facilities can be found nearby. Directly opposite the property to the front is a petrol station and Park Motor Group car dealer.
<b>Age</b>	Built in the 1970's and thereafter extended with the attic conversion in the 1990's, while more recent alterations include the addition of the side entrance vestibule and utility space in 2012 as per the Angus Local Authority Planning Portal.
<b>Weather</b>	Dry and bright.
<b>Chimney stacks</b>	<b>Visually inspected with the aid of binoculars where appropriate.</b>  None.

<p><b>Roofing including roof space</b></p>	<p><b>Sloping roofs were visually inspected with the aid of binoculars where appropriate.</b></p> <p><b>Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.</b></p> <p><b>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.</b></p> <p><b>If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</b></p> <p>The roof over the main dwelling and extended areas are of pitched timber construction externally clad in concrete tiles, which incorporates tiled detailing at the ridge line with PVC caps at the verge and metal lined valley gutters inset within the roof design. A dormer projection was added to accommodate the en-suite at first floor, this would appear to be of timber frame construction with PVC fascia boarding and a flat roof covering (unseen).</p> <p>The first floor accommodation is built within the original roof structure therefore limiting any inspection to residual areas where access has been made readily available. A restricted inspection of the roof timbers was undertaken from the eaves hatches, although the inspection was largely restricted due to the absence of flooring or crawl boards and a heavy presence of glass wool insulation material laid above and above and over the joists. No provision for access to any roof space over the extended areas.</p>
<p><b>Rainwater fittings</b></p>	<p><b>Visually inspected with the aid of binoculars where appropriate.</b></p> <p>PVC gutters and downpipes.</p>
<p><b>Main walls</b></p>	<p><b>Visually inspected with the aid of binoculars where appropriate.</b></p> <p><b>Foundations and concealed parts were not exposed or inspected.</b></p> <p>The main walls are of traditional cavity brick built construction, externally harled with facing brick and blockwork and PVC weatherboard panelling. The recent extensions would appear to be of timber frame construction with a masonry outer leaf finished in harling and facing brickwork to match the main dwelling.</p>

# Single Survey

<b>Windows, external doors and joinery</b>	<p><b>Internal and external doors were opened and closed where keys were available.</b></p> <p><b>Random windows were opened and closed where possible.</b></p> <p><b>Doors and windows were not forced open.</b></p> <p>The windows are primarily of replacement uPVC double glazed design with Velux style roof lights at first floor level.</p> <p>Access at the front elevation is via an older style aluminium/PVC double glazed entrance door with more modern PVC double glazed entrance doors accessible at the rear to the main vestibule and extended utility space.</p> <p>Replacement PVC eaves, fascia and soffit boarding to the external fabric.</p>
<b>External decorations</b>	<p><b>Visually inspected.</b></p> <p>Low maintenance PVC finishes.</p>
<b>Conservatories / porches</b>	<p><b>Visually inspected.</b></p> <p>None.</p>
<b>Communal areas</b>	<p><b>Circulation areas visually inspected.</b></p> <p>None apparent.</p>
<b>Garages and permanent outbuildings</b>	<p><b>Visually inspected.</b></p> <p>Detached single garage built on a concrete base, while the main walls are of brick built construction and the roof is of timber frame design overlaid in corrugated asbestos cement sheeting. Access is via a manual up and over entrance door and timber panel pedestrian door to the side. There is an electrical supply to the garage with light and power available and there is also a plumbed in sink unit.</p>
<b>Outside areas and boundaries</b>	<p><b>Visually inspected.</b></p> <p>The full extent of the site pertaining to the property should be outlined and confirmed with the Title Deeds.</p> <p>Private garden grounds are located at the front, side and rear elevation which also incorporates a paved mono-block driveway. Boundaries where determined are made up of masonry concrete block and brick built walls with timber fencing.</p>

# Single Survey

<b>Ceilings</b>	<b>Visually inspected from floor level.</b>  Ceilings are lined in plasterboard with painted, decorated and textured style finishes including woodchip and PVC lined panelling.
<b>Internal walls</b>	<b>Visually inspected from floor level.</b>  <b>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</b>  Internal partitions are of solid construction plastered on the hard and strapped and lined in plasterboard with painted, decorated and textured style finishes throughout.
<b>Floors including sub floors</b>	Suspended timber construction. Due to fitted carpets and floor coverings no detailed inspection was possible of the floors and accordingly no comment can be made on their condition. No access was available to any sub-floor areas.
<b>Internal joinery and kitchen fittings</b>	<b>Built-in cupboards were looked into but no stored items were moved.</b>  <b>Kitchen units were visually inspected excluding appliances.</b>  Kitchen units comprise wall and base mounted fixtures and fittings.  Internal doors are of timber flush panel and glazed design with skirtings and facings throughout.
<b>Chimney breasts and fireplaces</b>	<b>Visually inspected.</b>  <b>No testing of the flues or fittings was carried out.</b>  None.
<b>Internal decorations</b>	<b>Visually inspected.</b>  Painted and decorated finishes.
<b>Cellars</b>	<b>Visually inspected where there was a safe and purpose-built access.</b>  None.

# Single Survey

<b>Electricity</b>	<p><b>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</b></p> <p>Mains supply of electricity with the electrical consumer unit and meter located and boxed in within the original entrance vestibule.</p>
<b>Gas</b>	<p><b>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</b></p> <p>Mains supply of gas. The meter is boxed in at the rear elevation.</p>
<b>Water, plumbing, bathroom fittings</b>	<p><b>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>Mains supply of water with the plumbing where seen being of PVC and copper type.</p> <p>Sanitary fittings comprise a three piece fitted shower room suite at ground floor level, while there is an additional three piece shower room at first floor and alterations have been undertaken to form a three piece en-suite shower room from the main bedroom.</p>
<b>Heating and hot water</b>	<p><b>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>Gas fired central heating and hot water system via the 'Worcester Greenstar' boiler located in the kitchen and the thermal hot water storage tank can be found within the attic eaves off the main bedroom. Radiators in the main apartments with individual thermostatic control valves and copper piping where seen, while there are wall mounted towel rails within the sanitary apartments.</p>

<b>Drainage</b>	<p><b>Drainage covers etc. were not lifted.</b></p> <p><b>Neither drains nor drainage systems were tested.</b></p> <p>All foul and surface water drainage is presumed to be connected to the main public sewer. The system was not tested.</p>
<b>Fire, smoke and burglar alarms</b>	<p><b>Visually inspected.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>All Scottish homes require a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also needs to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon-fuelled appliance such as a boiler, open fire or wood burner, a carbon monoxide detector is also required. We have not assessed or tested any existing equipment and it is the purchasers responsibility to confirm that the property will comply with these standards following a change of ownership.</p>



<b>Any additional limits to inspection</b>	<p>Windows and external doors were not all fully opened or tested.</p> <p>Due to fitted carpets and floor coverings no detailed inspection was possible of the floors and accordingly no comment can be made on their condition. No access was available to any sub-floor areas. No inspection was at all possible of the flooring beneath any sanitary fittings, kitchen appliances or other wet areas.</p> <p>The first floor accommodation is built within the original roof structure therefore limiting any inspection to residual areas where access has been made readily available. A restricted inspection of the roof timbers was undertaken from the eaves hatches, although the inspection was largely restricted due to the absence of flooring or crawl boards and a heavy presence of glass wool insulation material laid above and above and over the joists. No provision for access to any roof space over the extended areas.</p> <p>We were not able to fully inspect all areas of boundary walls, fences and garden grounds due to garden vegetation/restricted access.</p> <p>No view of the flat roof coverings.</p> <p>An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor.</p>
--	--

## Sectional Diagram showing elements of a typical house



Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.


# Single Survey


## 2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

 Structural movement	
Repair category	1
Notes	There was no evidence of significant structural movement within the limitations of our inspection.

 Dampness, rot and infestation	
Repair category	1
Notes	Damp meter readings were taken where considered appropriate within the property and moisture levels were found to be within an acceptable range.

 Chimney stacks	
Repair category	N/A
Notes	Not applicable.



## Roofing including roof space

<b>Repair category</b>	2
<b>Notes</b>	<p>The original concrete roof tiles are typically weathered and worn with a generally heavy moss covering in places. There was no evidence of water penetration within the property and the roof appears to be functioning satisfactorily at present, however, roof coverings may be approaching the end of their efficient life span and future ongoing maintenance or full replacement will be required. Polystyrene used as insulation in the eaves. This could cause a hazard in the event of a fire and should be removed.</p> <p>Flat roof covering over the dormer projection. It should be appreciated that this type of covering can have a limited life span and will require a higher than normal degree of ongoing maintenance and eventual replacement. It may be prudent to confirm the service history of the roof covering.</p> <p>Prior to purchase further advice should be obtained from a roofing contractor to fully ascertain the condition and life expectancy of the covering.</p>



## Rainwater fittings

<b>Repair category</b>	1
<b>Notes</b>	<p>Within the limitations of our inspection rainwater goods were seen to be free from significant defect.</p> <p>We would highlight that it was not raining at the time of our inspection and we would recommend that all rainwater fittings be inspected during heavy rainfall in order to ensure they are free from defect.</p>



## Main walls

<b>Repair category</b>	2
<b>Notes</b>	<p>There is typical hairline cracking to the main walls and where tap tested bossed and hollow sections were noted. Maintenance/repairs will be required. Cracked/broken concrete window sills will require replacement.</p> <p>There are climbing plants and tree roots close to the main walls, particularly at the gable elevation and although a decorative feature these should be removed in line with good building practice.</p>

# Single Survey



## Windows, external doors and joinery

<b>Repair category</b>	2
<b>Notes</b>	Some windows when tested are catching on the frames when opening and closing, there are stiff handles and condensation to the margins, while the Velux style skylights will require attention in the short term. Some double glazed units are defective having failed and allowed condensation to form between the panes. Repairs, including the replacement of defective units, will be required. A glazier should advise further.



## External decorations

<b>Repair category</b>	1
<b>Notes</b>	No immediate action or repair is needed.



## Conservatories/porches

<b>Repair category</b>	N/A
<b>Notes</b>	Not applicable.



## Communal areas

<b>Repair category</b>	N/A
<b>Notes</b>	Not applicable.



## Garages and permanent outbuildings

<b>Repair category</b>	2
<b>Notes</b>	<p>The garage is of a basic type and design and will have a limited remaining life span. The front lintel and surrounding harling is significantly damaged with the steel reinforcements now visible. Rotten external joinery with basic front and side entrance doors, while the electrical installation is dated and no longer fit for purpose.</p> <p>The garage roof may contain materials with an asbestos content. These have not been tested and we have not carried out an asbestos survey on the property however these materials should be handled by a competent contractor only. Asbestos waste can be costly to dispose of.</p> <p>The economic viability of repair or replacement should be considered.</p>

# Single Survey



## Outside areas and boundaries

<b>Repair category</b>	2
<b>Notes</b>	Boundary walls and fences should be regularly checked and maintained as necessary. Routine maintenance and landscaping works will be required around the site and to the boundaries. Removal of the remaining tree stumps will be required and the link wall between the main dwelling and the boundary should be safely taken down.



## Ceilings

<b>Repair category</b>	1
<b>Notes</b>	Cosmetic plaster blemishes and age related wear and tear which should be attended to as part of routine maintenance and redecoration.



## Internal walls

<b>Repair category</b>	1
<b>Notes</b>	Cosmetic plaster blemishes and age related wear and tear which should be attended to as part of routine maintenance and redecoration.



## Floors including sub-floors

<b>Repair category</b>	1
<b>Notes</b>	Due to fitted carpets and floor coverings no detailed inspection of floors was possible and accordingly no comment can be made on their condition.



## Internal joinery and kitchen fittings

<b>Repair category</b>	1
<b>Notes</b>	Within the limitations of our inspection no significant defects were noted.  Low level internal glazing should be checked for safety glass.



## Chimney breasts and fireplaces

<b>Repair category</b>	N/A
<b>Notes</b>	Not applicable.

# Single Survey



## Internal decorations

<b>Repair category</b>	1
<b>Notes</b>	The internal decoration will require to be upgraded dependant on individual taste.



## Cellars

<b>Repair category</b>	N/A
<b>Notes</b>	Not applicable.



## Electricity

<b>Repair category</b>	2
<b>Notes</b>	<p>The electrical installation is of a mixed vintage. There are a number of original sockets and switches throughout, while by modern standards there are insufficient sockets in some apartments. Basic upgrading works have been undertaken in some areas with sockets sitting proud of the wall with surface lead trunking. The system should be fully checked by a registered electrician prior to purchase.</p> <p>The Institution of Engineering Technology recommends that inspections and testings are undertaken at least every five years and on a change of occupancy. It should be appreciated that only the most recently constructed or re-wired properties will have installations which fully comply with IET regulations.</p>



## Gas

<b>Repair category</b>	1
<b>Notes</b>	In the interests of safety and in light of recent regulations it would be prudent to have all gas appliances checked by a Gas Safe registered contractor.



## Water, plumbing and bathroom fittings

<b>Repair category</b>	1
<b>Notes</b>	No tests have been undertaken of the system, however within the limitations of our inspection, no significant defects were noted. No inspection has been possible to enclosed timbers beneath wet appliances and no comment has been made on the condition of unseen areas. Watertight seals will require to be regularly checked and replaced, to prevent water damage to adjoining areas.

# Single Survey



## Heating and hot water

<b>Repair category</b>	1
<b>Notes</b>	It is assumed that the central heating system has been properly installed, updated and maintained to meet with all current regulations and standards with particular regard to fluing and ventilation requirements. Service records should be obtained and checked. In the absence of service documentation further advice should be obtained from a qualified heating engineer to ascertain the condition, efficiency, and life expectancy of the system.



## Drainage

<b>Repair category</b>	1
<b>Notes</b>	All foul and surface water drainage is assumed to be to the main public sewer. The system was not tested.



# Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	N/A
Roofing including roof space	2
Rainwater fittings	1
Main walls	2
Windows, external doors and joinery	2
External decorations	1
Conservatories/porches	N/A
Communal areas	N/A
Garages and permanent outbuildings	2
Outside areas and boundaries	2
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	N/A
Internal decorations	1
Cellars	N/A
Electricity	2
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

## Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

## Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

## Category 1

No immediate action or repair is needed.

### Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

### Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

## 3. Accessibility information

### Guidance notes on accessibility information

*Three steps or fewer to a main entrance door of the property:*

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

*Unrestricted parking within 25 metres:*

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground & First (Attic) Floor.			
2. Are there three steps or fewer to a main entrance door of the property?	Yes	<input checked="" type="checkbox"/>	No	<input type="checkbox"/>
3. Is there a lift to the main entrance door of the property?	Yes	<input type="checkbox"/>	No	<input checked="" type="checkbox"/>
4. Are all door openings greater than 750mm?	Yes	<input type="checkbox"/>	No	<input checked="" type="checkbox"/>
5. Is there a toilet on the same level as the living room and kitchen?	Yes	<input checked="" type="checkbox"/>	No	<input type="checkbox"/>
6. Is there a toilet on the same level as a bedroom?	Yes	<input checked="" type="checkbox"/>	No	<input type="checkbox"/>
7. Are all rooms on the same level with no internal steps or stairs?	Yes	<input type="checkbox"/>	No	<input checked="" type="checkbox"/>
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes	<input checked="" type="checkbox"/>	No	<input type="checkbox"/>

## 4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

### Matters for a solicitor or licensed conveyancer

The property has been altered and extended to provide the current accommodation and layout. As per the Angus Local Authority Planning Portal the roof was converted in 1996, while more recent alterations include the addition of the vestibule, extended utility area and en-suite undertaken in approximately 2012. It is presumed where required that all relevant Local Authority consents and documentation are available and in order. This should be confirmed.

It is assumed that there are no statutory, town planning, road proposals or environmental matters which are likely to have an adverse effect on the property.

The road and footpath adjoining the site are made up and are assumed to be adopted by the Local Authority.

Where defects or repairs have been identified within this report it is recommended that, prior to entering into any legally binding sale or purchase contract, further specialist's or contractor's advice and estimates should be obtained, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property.

### Estimated reinstatement cost for insurance purposes

For Reinstatement Cost Assessment purposes, it is recommended that the subjects be insured for a sum of not less than £485,000 (FOUR HUNDRED AND EIGHTY-FIVE THOUSAND POUNDS).

This figure is the estimate of the cost of rebuilding the premises and bears no direct relationship to current market value.

### Valuation and market comments

Having considered matters, taking account of our general observations on site, we are of the opinion that the Market Value of the subjects in their present condition and with the benefit of vacant possession may be fairly stated in the sum of £285,000 (TWO HUNDRED AND EIGHTY-FIVE THOUSAND POUNDS).

<b>Signed</b>	<i>Barry Reid</i> Electronically signed :- 26/03/2025 10:00
<b>Report author</b>	Barry Reid
<b>Company name</b>	J & E Shepherd Chartered Surveyors

# Single Survey

<b>Address</b>	13 Albert Square Meadowside Dundee DD1 1XA
<b>Date of report</b>	10/03/2025

# Mortgage Valuation Report



## Property Address

Address 92 Grampian Gardens, Arbroath, DD11 4AQ  
Seller's Name Church of Scotland  
Date of Inspection 10/03/2025

## Property Details

Property Type  House  Bungalow  Purpose built maisonette  Converted maisonette  
 Purpose built flat  Converted flat  Tenement flat  Flat over non-residential use  
 Other (specify in General Remarks)

Property Style  Detached  Semi detached  Mid terrace  End terrace  
 Back to back  High rise block  Low rise block  Other (specify in General Remarks)

Does the surveyor believe that the property was built for the public sector, e. g. local authority, military, police?  Yes  No

Flats/Maisonettes only Floor(s) on which located  No. of floors in block  Lift provided?  Yes  No  
No. of units in block

Approximate Year of Construction

## Tenure

Absolute Ownership  Other

## Accommodation

Number of Rooms  Living room(s)  Bedroom(s)  Kitchen(s)  
 Bathroom(s)  WC(s)  Other (Specify in General remarks)

Gross Floor Area (excluding garages and outbuildings)  m<sup>2</sup> (Internal)  m<sup>2</sup> (External)

Residential Element (greater than 40%)  Yes  No

## Garage / Parking / Outbuildings

Single garage  Double garage  Parking space  No garage / garage space / parking space

Available on site?  Yes  No

### Permanent outbuildings:

No permanent outbuildings.

# Mortgage Valuation Report

## Construction

Walls  Brick  Stone  Concrete  Timber frame  Other (specify in General Remarks)  
Roof  Tile  Slate  Asphalt  Felt  Other (specify in General Remarks)

## Special Risks

Has the property suffered structural movement?  Yes  No

If Yes, is this recent or progressive?  Yes  No

Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in the immediate vicinity?  Yes  No

If Yes to any of the above, provide details in General Remarks.

## Service Connections

Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in General Remarks

Drainage  Mains  Private  None  
Electricity  Mains  Private  None  
Central Heating  Yes  Partial  None  
Water  Mains  Private  None  
Gas  Mains  Private  None

Brief description of Central Heating and any non mains services:

Gas fired central heating system.

## Site

Apparent legal issues to be verified by the conveyancer. Please provide a brief description in General Remarks.

Rights of way  Shared drives / access  Garage or other amenities on separate site  Shared service connections  
 Ill-defined boundaries  Agricultural land included with property  Other (specify in General Remarks)

## Location

Residential suburb  Residential within town / city  Mixed residential / commercial  Shared service connections  
 Commuter village  Remote village  Isolated rural property  Other (specify in General Remarks)

## Planning Issues

Has the property been extended / converted / altered?  Yes  No

If Yes provide details in General Remarks.

## Roads

Made up road  Unmade road  Partly completed new road  Pedestrian access only  Adopted  Unadopted

# Mortgage Valuation Report

## General Remarks

The subjects comprise an extended detached chalet style villa. The property forms part of a private residential development of largely similar style properties, which lies to the north-east of central Arbroath where a wide range of local amenities and facilities can be found nearby. Directly opposite the property to the front is a petrol station and Park Motor Group car dealer.

At the time of inspection the property was found to be in a condition generally consistent with its age and type of construction but some works of maintenance and repair are required. Elements of the property are aging and likely to require attention.

Other Accommodation: Home Office/Study.

The property has been altered and extended to provide the current accommodation and layout. As per the Angus Local Authority Planning Portal the roof was converted in 1996, while more recent alterations include the addition of the vestibule, extended utility area and en-suite undertaken in approximately 2012. It is presumed where required that all relevant Local Authority consents and documentation are available and in order. This should be confirmed.

## Essential Repairs

None.

Estimated cost of essential repairs

Retention recommended?  Yes  No

Retention amount

## Comment on Mortgageability

The property forms suitable security for mortgage purposes subject to the specific lending criteria of any mortgage provider.

## Valuation

Market value in present condition £

Market value on completion of essential repairs £

Insurance reinstatement value £

(to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)

Is a reinspection necessary?  Yes  No

# Mortgage Valuation Report

## Declaration

Signed	<i>Barry Reid</i> Electronically signed :- 26/03/2025 10:00
Surveyor's name	Barry Reid
Professional qualifications	MRICS
Company name	J & E Shepherd Chartered Surveyors
Address	13 Albert Square, Meadowside, Dundee, DD1 1XA
Telephone	01382 200454
Email Address	dundeeresidential@shepherd.co.uk
Date of Inspection	10/03/2025





**Energy  
Performance  
Certificate**



# Energy Performance Certificate (EPC)

# Scotland

Dwellings

SIBIRSKIE, 92 GRAMPIAN GARDENS, ARBROATH, DD11 4AQ

**Dwelling type:** Detached house  
**Date of assessment:** 10 March 2025  
**Date of certificate:** 11 March 2025  
**Total floor area:** 197 m<sup>2</sup>  
**Primary Energy Indicator:** 198 kWh/m<sup>2</sup>/year

**Reference number:** 0140-2360-9170-2195-0161  
**Type of assessment:** RdSAP, existing dwelling  
**Approved Organisation:** Elmhurst  
**Main heating and fuel:** Boiler and radiators, mains gas

## You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO<sub>2</sub> emissions by improving your home

Estimated energy costs for your home for 3 years\*

£6,090


See your recommendations report for more information

Over 3 years you could save\*

£1,140

\* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

Very energy efficient - lower running costs

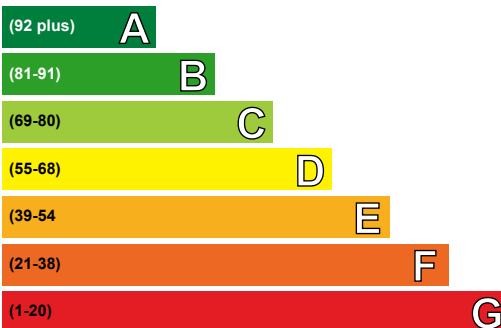

Current	Potential
72	83

## Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band C (72)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Not energy efficient - higher running costs

Very environmentally friendly - lower CO<sub>2</sub> emissions



Current	Potential
66	78

## Environmental Impact (CO<sub>2</sub>) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO<sub>2</sub>) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band D (66)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Not environmentally friendly - higher CO<sub>2</sub> emissions

## Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Cavity wall insulation	£500 - £1,500	£294.00
2 Floor insulation (suspended floor)	£800 - £1,200	£636.00
3 Solar water heating	£4,000 - £6,000	£207.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit [greenerscotland.org](http://greenerscotland.org) or contact Home Energy Scotland on 0808 808 2282.

**THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE**

## Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Cavity wall, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
	Timber frame, as built, insulated (assumed)	★★★★★	★★★★★
Roof	Pitched, 300 mm loft insulation	★★★★★	★★★★★
	Roof room(s), insulated (assumed)	★★★★☆	★★★★☆
Floor	Suspended, no insulation (assumed)	—	—
Windows	Fully double glazed	★★★★☆	★★★★☆
Main heating	Boiler and radiators, mains gas	★★★★☆	★★★★☆
Main heating controls	Programmer, room thermostat and TRVs	★★★★☆	★★★★☆
Secondary heating	None	—	—
Hot water	From main system	★★★★☆	★★★★☆
Lighting	Low energy lighting in 91% of fixed outlets	★★★★★	★★★★★

## The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO<sub>2</sub> emissions, running costs and the savings possible from making improvements.


## The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 35 kg CO<sub>2</sub>/m<sup>2</sup>/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 6.9 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 2.4 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.









## Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£5,013 over 3 years	£4,101 over 3 years	
Hot water	£600 over 3 years	£372 over 3 years	
Lighting	£477 over 3 years	£477 over 3 years	
<b>Totals</b>	<b>£6,090</b>	<b>£4,950</b>	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

## Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Cavity wall insulation	£500 - £1,500	£98		
2 Floor insulation (suspended floor)	£800 - £1,200	£212		
3 Solar water heating	£4,000 - £6,000	£69		
4 Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£426		

### Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- External insulation with cavity wall insulation

## Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to [www.greenerscotland.org](http://www.greenerscotland.org).

## About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

### 1 Cavity wall insulation

Cavity wall insulation, to fill the gap between the inner and outer layers of external walls with an insulating material, reduces heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. The insulation material is pumped into the gap through small holes that are drilled into the outer walls, and the holes are made good afterwards. As specialist machinery is used to fill the cavity, a professional installation company should carry out this work, and they should carry out a thorough survey before commencing work to ensure that this type of insulation is suitable for this home and its exposure. They should also provide a guarantee for the work and handle any building standards issues. Further information about cavity wall insulation and details of local installers can be obtained from the National Insulation Association ([www.nationalinsulationassociation.org.uk](http://www.nationalinsulationassociation.org.uk)).

### 2 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including [www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation](http://www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation). Building regulations generally apply to this work so it is best to check with your local authority building standards department.

### 3 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at [www.microgenerationcertification.org](http://www.microgenerationcertification.org).

### 4 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at [www.microgenerationcertification.org](http://www.microgenerationcertification.org).

## Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

**LZC energy sources present:** There are none provided for this home

## Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	23,773	N/A	(1,537)	N/A
Water heating (kWh per year)	3,002			

## Addendum

### About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst ([www.elmhurstenergy.co.uk](http://www.elmhurstenergy.co.uk)), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk) and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Barry Reid
Assessor membership number:	EES/016131
Company name/trading name:	J & E Shepherd
Address:	12 Atholl Crescent Edinburgh EH3 8HA
Phone number:	0131 225 1234
Email address:	<a href="mailto:edinburgh@shepherd.co.uk">edinburgh@shepherd.co.uk</a>
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

### Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk), with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at [www.gov.scot/epc](http://www.gov.scot/epc).

## Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

**HOMEENERGYSCOTLAND.ORG**  
**0808 808 2282**  
FUNDED BY THE SCOTTISH GOVERNMENT





# Property Questionnaire





# property questionnaire

<b>Property Address</b>	92 Grampian Gardens Arbroath Angus DD11 4AQ
<b>Seller(s)</b>	The Church of Scotland General Trustees
<b>Completion date of Property Questionnaire</b>	7 March 2025

## Note for sellers

- Please complete this form carefully. It is important your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell you solicitor or estate agent immediately.

## Information to be given to prospective buyer(s)

<b>1.</b>	<b>Length of Ownership</b>
	<p>How long have you owned the property? <input style="width: 150px; height: 20px;" type="text" value="Entry date - 30 September 2005"/></p>
<b>2.</b>	<b>Council Tax</b>
	<p>Which Council Tax band is your property in?</p> <p> <input type="checkbox"/> A                <input type="checkbox"/> B                <input type="checkbox"/> C                <input type="checkbox"/> D                <input checked="" type="checkbox"/> E                <input type="checkbox"/> F                <input type="checkbox"/> G                <input type="checkbox"/> H         </p>
<b>3.</b>	<b>Parking</b>
	<p>What are the arrangements for parking at your property?</p> <p>(Please tick all that apply)</p> <p>Garage <input checked="" type="checkbox"/></p> <p>Allocated parking space <input type="checkbox"/></p> <p>Driveway <input checked="" type="checkbox"/></p> <p>On street <input type="checkbox"/></p> <p>Resident Permit <input type="checkbox"/></p> <p>Metered parking <input type="checkbox"/></p> <p>Shared parking <input type="checkbox"/></p> <p>Other (please specify) <input style="width: 300px; height: 20px;" type="text"/></p>

# property questionnaire

<b>4.</b>	<b>Conservation area</b>	
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	<b>Please select</b> No
<b>5.</b>	<b>Listed buildings</b>	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	<b>Please select</b> No
<b>6.</b>	<b>Alterations/Additions/Extensions</b>	
<b>a.</b>	<p><b>(i)</b> During your time in the property, have you carried out any structural alterations, additions or extensions (for example provision of an extra bath/shower room, toilet or bedroom)? If you have answered <u>yes</u>, please describe below the changes which you have made:</p> <div data-bbox="159 931 1163 1066" style="border: 1px solid black; padding: 5px; margin: 10px 0;"> <p>Side extension to form vestibule. Rear extension to form utility room. Dormer extension to form en-suite.</p> </div> <p><b>(ii)</b> Did you obtain planning permission, building warrant, completion certificate and other consents for this work?</p> <p>If you have answered <u>yes</u>, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking. If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them.</p>	<p><b>Please select</b> Yes</p> <p><b>Please select</b> Yes Assume they are with deeds at 121.</p>
<b>b.</b>	<p>Have you had replacement windows, doors, patio doors or double-glazing installed in your property? If you have answered yes, please answer the three questions below:</p> <p><b>(i)</b> Were the replacements the same shape and type as the ones you replaced?</p> <p><b>(ii)</b> Did this work involve any changes to the window or door openings?</p> <p><b>(iii)</b> Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):</p> <div data-bbox="159 1901 1150 2016" style="border: 1px solid black; padding: 5px; margin: 10px 0;"> <p>6 x UPVC windows replaced on ground floor - 2016</p> </div>	<p><b>Please select</b> Yes</p> <p><b>Please select</b> Yes</p> <p><b>Please select</b> No</p>

<b>7.</b>	<b>Central heating</b>	
	<p>Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom).</p> <p>If you have answered <u>yes</u> or <u>partial</u> – what kind of central heating is there?</p> <div style="border: 1px solid black; padding: 5px; margin-bottom: 5px;">Mains gas boiler</div> <p>(examples: gas-fired, solid fuel, electric storage heating, gas-warm air).</p> <p>If you have answered <u>yes</u>, please answer the three questions below:</p>	<p><b>Please select</b></p> <p>Yes</p>
	<p><b>(i)</b> When was your central heating system or partial central heating system installed?</p> <div style="border: 1px solid black; padding: 5px; margin-bottom: 10px;">2012</div> <p><b>(ii)</b> Do you have a maintenance contract for the central heating system?</p> <p>If you have answered <u>yes</u>, please give details of the company with which you have a maintenance contract:</p> <div style="border: 1px solid black; padding: 5px; margin-bottom: 10px;">British Gas Home Care Plan until November 2024</div> <p><b>(iii)</b> When was your maintenance agreement last renewed? (Please provide the month and year).</p> <div style="border: 1px solid black; padding: 5px;">Last service December 2023</div>	<p><b>Please select</b></p>
<b>8.</b>	<b>Energy Performance Certificate</b>	
	<p>Does your property have an Energy Performance Certificate, which is less than 10 years old?</p>	<p><b>Please select</b></p> <p>Yes</p>
<b>9.</b>	<b>Issues that may have affected your property</b>	
<b>a.</b>	<p>Has there been any storm, flood, fire or other structural damage to your property while you have owned it?</p> <p>If you have answered <u>yes</u>, is the damage the subject of any outstanding insurance claim?</p>	<p><b>Please select</b></p> <p>No</p> <p><b>Please select</b></p>

<p><b>b.</b></p>	<p>Are you aware of the existence of asbestos in your property?</p> <p>If you have answered <u>yes</u>, please give details:</p> <div style="border: 1px solid black; height: 40px; width: 100%;"></div>	<p><b>Please select</b></p> <p>No</p>																								
<p><b>10.</b></p>	<p><b>Services</b></p>																									
<p><b>a.</b></p>	<p>Please tick which services are connected to your property and give details of the supplier:</p> <table border="0" style="width: 100%;"> <thead> <tr> <th style="text-align: left;"><b>Services</b></th> <th style="text-align: center;"><b>Connected</b></th> <th style="text-align: left;"><b>Supplier</b></th> </tr> </thead> <tbody> <tr> <td>Gas or liquid petroleum gas</td> <td style="text-align: center;"><input checked="" type="checkbox"/></td> <td><div style="border: 1px solid black; padding: 2px;">EDF</div></td> </tr> <tr> <td>Water mains or private water supply</td> <td style="text-align: center;"><input checked="" type="checkbox"/></td> <td><div style="border: 1px solid black; padding: 2px;">Mains</div></td> </tr> <tr> <td>Electricity</td> <td style="text-align: center;"><input checked="" type="checkbox"/></td> <td><div style="border: 1px solid black; padding: 2px;">EDF</div></td> </tr> <tr> <td>Mains drainage</td> <td style="text-align: center;"><input checked="" type="checkbox"/></td> <td><div style="border: 1px solid black; padding: 2px;">Mains</div></td> </tr> <tr> <td>Telephone</td> <td style="text-align: center;"><input type="checkbox"/></td> <td><div style="border: 1px solid black; height: 20px; width: 100%;"></div></td> </tr> <tr> <td>Cable TV or satellite</td> <td style="text-align: center;"><input type="checkbox"/></td> <td><div style="border: 1px solid black; height: 20px; width: 100%;"></div></td> </tr> <tr> <td>Broadband</td> <td style="text-align: center;"><input type="checkbox"/></td> <td><div style="border: 1px solid black; height: 20px; width: 100%;"></div></td> </tr> </tbody> </table>	<b>Services</b>	<b>Connected</b>	<b>Supplier</b>	Gas or liquid petroleum gas	<input checked="" type="checkbox"/>	<div style="border: 1px solid black; padding: 2px;">EDF</div>	Water mains or private water supply	<input checked="" type="checkbox"/>	<div style="border: 1px solid black; padding: 2px;">Mains</div>	Electricity	<input checked="" type="checkbox"/>	<div style="border: 1px solid black; padding: 2px;">EDF</div>	Mains drainage	<input checked="" type="checkbox"/>	<div style="border: 1px solid black; padding: 2px;">Mains</div>	Telephone	<input type="checkbox"/>	<div style="border: 1px solid black; height: 20px; width: 100%;"></div>	Cable TV or satellite	<input type="checkbox"/>	<div style="border: 1px solid black; height: 20px; width: 100%;"></div>	Broadband	<input type="checkbox"/>	<div style="border: 1px solid black; height: 20px; width: 100%;"></div>	
<b>Services</b>	<b>Connected</b>	<b>Supplier</b>																								
Gas or liquid petroleum gas	<input checked="" type="checkbox"/>	<div style="border: 1px solid black; padding: 2px;">EDF</div>																								
Water mains or private water supply	<input checked="" type="checkbox"/>	<div style="border: 1px solid black; padding: 2px;">Mains</div>																								
Electricity	<input checked="" type="checkbox"/>	<div style="border: 1px solid black; padding: 2px;">EDF</div>																								
Mains drainage	<input checked="" type="checkbox"/>	<div style="border: 1px solid black; padding: 2px;">Mains</div>																								
Telephone	<input type="checkbox"/>	<div style="border: 1px solid black; height: 20px; width: 100%;"></div>																								
Cable TV or satellite	<input type="checkbox"/>	<div style="border: 1px solid black; height: 20px; width: 100%;"></div>																								
Broadband	<input type="checkbox"/>	<div style="border: 1px solid black; height: 20px; width: 100%;"></div>																								
<p><b>b.</b></p>	<p><b>Is there a septic tank system at your property?</b></p> <p>If you have answered <u>yes</u>, please answer the two questions below:</p> <p><b>(i)</b> Do you have appropriate consents for the discharge from your septic tank?</p> <p><b>(ii)</b> Do you have a maintenance contract for your septic tank?</p> <p>If you have answered <u>yes</u>, please give details of the company with which you have a maintenance contract:</p> <div style="border: 1px solid black; height: 40px; width: 100%;"></div>	<p><b>Please select</b></p> <p>No</p> <p><b>Please select</b></p> <p><b>Please select</b></p>																								

11.	Responsibilities for shared or common areas	
a.	<p>Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?</p> <p>If you have answered <u>yes</u>, please give details:</p> <div data-bbox="156 456 1149 629" style="border: 1px solid black; height: 77px; width: 622px;"></div>	<p><b>Please select</b></p> <p>No</p>
b.	<p>Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?</p> <p>If you have answered <u>yes</u>, please give details:</p> <div data-bbox="156 860 1149 1032" style="border: 1px solid black; height: 77px; width: 622px;"></div>	<p><b>Please select</b></p> <p>No</p>
c.	<p>Has there been any major repair or replacement of any part of the roof during the time you have owned the property?</p>	<p><b>Please select</b></p> <p>No</p>
d.	<p>Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries?</p> <p>If you have answered <u>yes</u>, please give details:</p> <div data-bbox="156 1395 1149 1568" style="border: 1px solid black; height: 77px; width: 622px;"></div>	<p><b>Please select</b></p> <p>No</p>
e.	<p>As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?</p> <p>If you have answered <u>yes</u>, please give details:</p> <div data-bbox="156 1830 1149 2002" style="border: 1px solid black; height: 77px; width: 622px;"></div>	<p><b>Please select</b></p> <p>No</p>

# property questionnaire

f.	<p>As far as you are aware, is there a public right of way across any part of your property (public right of way is a way over privately-owned)?</p> <p>If you have answered <u>yes</u>, please give details:</p> <div style="border: 1px solid black; height: 70px; width: 100%;"></div>	<p><b>Please select</b></p> <p>No</p>
<b>12. Charges associated with your property</b>		
a.	<p>Is there a factor or property manager for your property?</p> <p>If you have answered <u>yes</u>, please provide the name and address, and give details of any deposit held and approximate charges:</p> <div style="border: 1px solid black; height: 70px; width: 100%;"></div>	<p><b>Please select</b></p> <p>No</p>
b.	<p>Is there a common buildings insurance policy?</p> <p>If you have answered <u>yes</u>, is the cost of the insurance included in your monthly/annual factor's charges?</p>	<p><b>Please select</b></p> <p>No</p> <p><b>Please select</b></p>
c.	<p>Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.</p> <div style="border: 1px solid black; height: 70px; width: 100%;"></div>	<p>N/A</p>

# property questionnaire

13.	<b>Specialist works</b>	
a.	<p>As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?            If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property:</p> <div data-bbox="156 468 1147 640" style="border: 1px solid black; height: 77px; width: 621px;"></div>	<p><b>Please select</b></p> <p>No</p>
b.	<p>As far as you were aware, has any preventative work for dry rot, wet rot, or damp, ever been carried out to your property?            If you have answered yes, please give details:</p> <div data-bbox="156 882 1147 1055" style="border: 1px solid black; height: 77px; width: 621px;"></div>	<p><b>Please select</b></p> <p>No</p>
c.	<p>If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?            If you have answered yes these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. Guarantees are held by:</p> <div data-bbox="156 1451 1147 1547" style="border: 1px solid black; height: 43px; width: 621px;"></div>	<p><b>Please select</b></p>



<b>14.</b>	<b>Guarantees</b>	
<b>a.</b>	<p>Are there any guarantees or warranties for any of the following:</p> <ul style="list-style-type: none"> <li><b>(i)</b> Electrical work</li> <li><b>(ii)</b> Roofing</li> <li><b>(iii)</b> Central heating</li> <li><b>(iv)</b> National House Building Council (NHBC)</li> <li><b>(v)</b> Damp course</li> <li><b>(vi)</b> Any other work or installations (for example, cavity wall insulation, underpinning, indemnity policy)</li> </ul>	<p><b>Please select</b> No</p> <p><b>Please select</b> No</p> <p><b>Please select</b> No</p> <p><b>Please select</b> No</p> <p><b>Please select</b> No</p> <p><b>Please select</b></p>
<b>b.</b>	<p>If you have answered yes or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):</p> <div data-bbox="156 913 1150 1088" style="border: 1px solid black; height: 78px; width: 623px;"></div>	
<b>c.</b>	<p>Are there any outstanding claims under any of the guarantees listed above?</p> <p><u>If you have answered yes</u>, please give details:</p> <div data-bbox="156 1335 1150 1509" style="border: 1px solid black; height: 78px; width: 623px;"></div>	<p><b>Please select</b></p> <p>No</p>
<b>15.</b>	<b>Boundaries</b>	
	<p>So far as you are aware, has any boundary of your property been moved in the last 10 years?</p> <p><u>If you have answered yes</u>, please give details:</p> <div data-bbox="156 1805 1150 1980" style="border: 1px solid black; height: 78px; width: 623px;"></div>	<p><b>Please select</b></p> <p>No</p>

# property questionnaire

16.	Notices that affect your property	
	<p><b>In the past three years have you ever received a notice:</b></p> <p><b>a.</b> advising that the owner of a neighbouring property has made a planning application?</p> <p><b>b.</b> that affects your property in some other way?</p> <p><b>c.</b> that requires you to do any maintenance, repairs or improvements to your property?</p> <p><u>If you have answered yes to any of a–c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.</u></p>	<p><b>Please select</b> No</p> <p><b>Please select</b> No</p> <p><b>Please select</b> No</p>

## Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s): Ross Cargill, Fabric Convenor

Date: 7 March 2025



- Home Report
- Valuation Report
- Executory Valuation
- Tax Valuations
- Separation Valuation
- Private Sale Valuation
- New Build & Plot Valuation
- Insurance Reinstatement Valuation
- Portfolio Valuation
- Rental Valuation
- Drive By & Desktop Valuation
- Energy Performance Certificate (EPC)
- Level Two Survey & Valuation Report
- Level Two Condition Report
- Expert Witness Report

- Commercial Valuation
- Commercial Agency
- Acquisitions Consultancy
- Commercial Lease Advisory
- Rent Reviews
- Asset Management
- Development Appraisals & Consultancy
- Auctions
- Property Management
- Professional Services
- Licensed Trade & Leisure
- Expert Witness Report
- Rating
- Property Investment
- Public Sector

- Quantity Surveying
- Building Surveying
- Project Management
- Dispute Resolution Support Services
- Principal Designer
- Clerk of Works
- Commercial EPC
- Health & Safety Management
- Employer's Agent
- Energy Consultancy
- Housing Partnerships
- Housing Consultancy
- Development Monitoring
- Mediation Services

**Aberdeen**  
△△△ 01224 202800

**Ayr**  
△△ 01292 267987

**Bearsden**  
△△ 0141 611 1500

**Belfast**  
△ 02890 912975

**Birmingham**  
△ 0121 270 2266

**Coatbridge**  
△△ 01236 436561

**Cumbernauld**  
△△ 01236 780000

**Dalkeith**  
△△ 0131 663 2780

**Dumbarton**  
△△ 01389 731682

**Dumfries**  
△△△ 01387 264333

**Dundee**  
△△ 01382 200454  
△ 01382 220699

**Dunfermline**  
△△ 01383 722337  
△ 01383 731841

**East Kilbride**  
△△ 01355 229317

**Edinburgh**  
△△ 0131 2251234  
△ 0131 557 9300

**Elgin**  
△△ 01343 553939

**Falkirk**  
△△ 01324 635 999

**Fraserburgh**  
△△ 01346 517456

**Galashiels**  
△△ 01896 750150

**Glasgow**  
△△△ 0141 331 2807

**Glasgow South**  
△△ 0141 649 8020

**Glasgow West End**  
△△ 0141 353 2080

**Greenock**  
△△ 01475 730717

**Hamilton**  
△△ 01698 891400

**Inverness**  
△△△ 01463 712239

**Kilmarnock**  
△△ 01563 520318

**Kirkcaldy**  
△△ 01592 205442

**Lanark**  
△△ 01555 663058

**Leeds**  
△ 0113 322 5069

**Livingston**  
△△ 01506 416777

**London**  
△△ 02033 761 236

**Montrose**  
△△ 01674 676768

**Musselburgh**  
△△ 0131 653 3456

**Oban**  
△△ 01631 707 800

**Paisley**  
△△ 0141 889 8334

**Perth**  
△△ 01738 638188  
△ 01738 631631

**Peterhead**  
△△ 01779 470766

**St Andrews**  
△△ 01334 477773  
△ 01334 476469

**Saltcoats**  
△△ 01294 464228

**Stirling**  
△△ 01786 450438  
△ 01786 474476