

Home Report

shepherd.co.uk



All Angles Covered

Residential | Commercial | Property & Construction





Contents

- 1. Scottish Single Survey
- 2. Energy Performance Certificate
- 3. Property Questionnaire



Scottish
Single Survey



survey report on:

Property address	2 East Savile Road Edinburgh EH16 5ND
Customer	Church of Scotland
Customer address	2 East Savile Road Edinburgh EH16 5ND
Prepared by	Shepherd Chartered Surveyors
Date of inspection	17/01/2025



www.shepherd.co.uk

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by marking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller:
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether
 or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report².

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;

- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments

being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 <u>Category 3:</u> Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 <u>Category 2:</u> Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use

communal grounds, parking areas, and other facilities;

- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	The property comprises a semi-detached house.
Accommodation	Ground Floor - Entrance Vestibule, Hallway, Living Room, Bedroom, Dining Room with Kitchen and Store Cupboard off and Shower Room with WC First Floor - Landing, Drawing Room/Bedroom, 3 further Bedrooms and Bathroom with WC
Gross internal floor area (m²)	207m2 or thereby.
Neighbourhood and location	The subjects are situated within an established residential area where neighbouring properties are of a similar age and type. Adequate amenities can be found nearby.
Age	1890 or thereby.
Weather	Dry and overcast.
Chimney stacks	Visually inspected with the aid of binoculars where appropriate. Masonry with clay pots.

Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate. Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally. Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor
	deems it safe and reasonable to do so. The roof is pitched and laid in slate incorporating flat roof sections and valley guttering. A roof hatch was noted within the first floor bathroom however no access was gained at the time of inspection due to Health and Safety restrictions.
Rainwater fittings	Visually inspected with the aid of binoculars where appropriate.
	Cast iron gutters and downpipes.
Main walls	Visually inspected with the aid of binoculars where appropriate.
	Foundations and concealed parts were not exposed or inspected.
	The main walls are of stone construction pointed externally.
Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available.
	Random windows were opened and closed where possible.
	Doors and windows were not forced open.
	Windows throughout are of timber sash and case single glazed type. There are front and rear access doors.
External decorations	Visually inspected.
	Painted finishes noted.
Conservatories / porches	Visually inspected.
·	Not applicable.

[I
Communal areas	Circulation areas visually inspected.
	Not applicable.
Garages and permanent outbuildings	Visually inspected.
	Not applicable.
Outside areas and boundaries	Visually inspected
Outside areas and boundaries	Visually inspected.
	There is private garden ground to the front and rear of the property bounded by a mixture of boundaries.
Ceilings	Visually inspected from floor level.
	Presumed plastered ceilings throughout.
Internal walls	Visually inspected from floor level.
	Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
	Internal walls have plaster finishes.
Floors including sub floors	Flooring throughout appears to be a mixture of solid masonry and timber construction. There are some fitted floor coverings throughout the property. No sub-floor areas were inspected.
Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved.
	Kitchen units were visually inspected excluding appliances.
	Internal joinery - timber.
	Internal doors - timber panel type.
	Kitchen storage is provided by a range of fitted units incorporating worktop surface areas.
Chimney breasts and fireplaces	Visually inspected.
1	
	No testing of the flues or fittings was carried out.

Internal decorations	Visually inspected.
	Painted, papered and tiled finishes noted.
Cellars	Visually inspected where there was a safe and purpose- built access.
	None noted at the time of inspection.
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. Mains supply with the electric meter located in the entrance vestibule.
Gas	Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.
	Mains supply.
Water, plumbing, bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.
	No tests whatsoever were carried out to the system or appliances.
	Mains supply. There is a sink unit in the kitchen.
	Sanitary arrangements - three piece suites in the bathroom and shower room.

Fire, smoke and burglar alarms

Heating and hot water Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation. No tests whatsoever were carried out to the system or appliances. The property benefits from a gas fired central heating system serving steel panel radiators. Domestic hot water is presumed provided via the boiler.

Drainage Covers etc. were not lifted. Neither drains nor drainage systems were tested. Presumed to the main public sewer.

Visually inspected.

No tests whatsoever were carried out to the system or appliances.
All Scottish homes require a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also needs to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbonfuelled appliance such as a boiler, open fire or wood burner, a carbon monoxide detector is also required. We have not assessed or tested any existing equipment and it is the purchasers responsibility to confirm that the property will comply with these standards following a change of ownership.

Any additional limits to inspection

For flats / maisonettes

Only the subject flat and internal communal areas giving access to the flat were inspected.

If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.

The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.

At the time of inspection some floors were covered.

No sub-floor areas were inspected.

No access was gained below or beyond sanitary arrangements.

No access was gained to any roof void areas.

A restricted inspection was carried out to site boundaries due to overgrown plantation.


Chimneys and roof decks were viewed from ground floor level.

This report should not be construed as a detailed and intrusive structural survey.

Properties built prior to 1999 may contain elements of asbestos materials however an asbestos survey has not been carried out.

An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor.

Sectional Diagram showing elements of a typical house

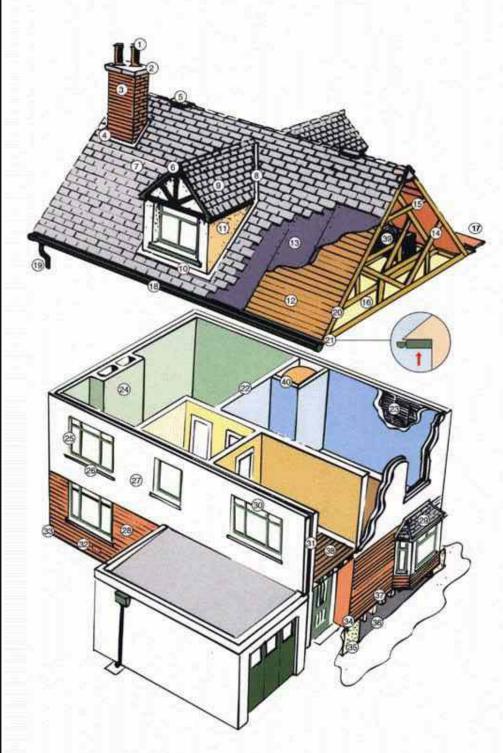

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

- 1) Chimney pots
- 2) Coping stone
- 3 Chimney head
- 4) Flashing
- 5) Ridge ventilation
- 6) Ridge board
- (7) Slates / tiles
- 8 Valley guttering
- 9 Dormer projection
- 10 Dormer flashing
- 11) Dormer cheeks
- 12) Sarking
- 13) Roof felt
- (14) Trusses
- (15) Collar
- 16) Insulation
- (17) Parapet gutter
- 18) Eaves guttering
- (19) Rainwater downpipe
- 20) Verge boards /skews
- Soffit boards
- 22) Partition wall
- 23) Lath / plaster
- (24) Chimney breast
- 25) Window pointing
- 26) Window sills
- 27) Rendering
- (28) Brickwork / pointing
- (29) Bay window projection
- (30) Lintels
- (31) Cavity walls / wall ties
- 32) Subfloor ventilator
- (33) Damp proof course
- 34) Base course
- 35) Foundations
- 36) Solum
- 37) Floor joists
- 38) Floorboards
- 39) Water tank
- 40) Hot water tank

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
	Repairs or replacement requiring future attention, but estimates are still advised.	

Structural movement	
Repair category	1
Notes	It appears the property has suffered from previous movement evident to distortions to the internal and external fabric. Within the limitations of a single survey and for the purposes of this valuation this appears longstanding and non-progressive in nature.

Dampness, rot and infestation	
Repair category	3
Notes	Moisture meter readings were recorded within the property in particular to the rear outshot at lower ground level. Evidence of water ingress was noted around the cupola and above the staircase. Remedial works are required and we recommend a check of the entire subjects is carried out by a qualified damp and timber specialist who can provide advice and estimates on all necessary remedial works required prior to purchase. Any estimates and recommendations should be undertaken thereafter.
	A restricted damp inspection was carried out due to the presence of linings and fittings. No comment can be made on the condition of the fabric below any floor coverings or behind any wall linings.

Chimney stacks	
Repair category	2
Notes	Weathered and damaged masonry was noted. Remedial works are required. A precautionary check of the chimney stacks and surrounding flashings should be undertaken by a qualified roofing contractor prior to purchase. A qualified roofing contractor can provide advice and recommendations on any necessary remedial works prior to purchase. Our inspection of chimneys was limited but they are of an age and style where a degree of regular ongoing maintenance should be anticipated. Chimney stacks were viewed from ground floor level only.

Roofing including roof space	
Repair category	3
Notes	Evidence of water ingress was noted around the cupola and above the staircase. Cracked slates were noted. Flat roof coverings have a limited life and will require regular and ongoing maintenance with a higher than average maintenance cost. We recommend a precautionary check of the roof decks, pertinents and void areas are carried out by a qualified roofing contractor prior to purchase.
	A qualified roofing contractor can provide advice and recommendations on all necessary remedial works required prior to purchase. Roof coverings were viewed from ground floor level.

Rainwater fittings	
Repair category	2
Notes	Sections of the rainwater fittings were noted to be weathered and corroded. Where previous leakage or overflow from rainwater goods has occurred a precautionary check of the surrounding building fabric is recommended with particular reference to damp or rot related defects. We would highlight that it was not raining at the time of our inspection and we would recommend that all rainwater fittings be inspected during heavy rainfall in order to ensure they are free from defect. Remedial works are required.

Main walls	
Repair category	2
Notes	Weathered and damaged masonry was noted. Remedial works are required and estimates should be obtained.

Windows, external doors and joinery	
Repair category	2
Notes	Cracked mastic sealant was noted around a number of the window units. Weathered timber units were noted. An overhaul of all window units and doors is recommended to be carried out by a qualified contractor. A precautionary check of all windows and doors is recommended prior to purchase.

External decorations	
Repair category	2
Notes	The external décor is weathered. Painted timbers will require future redecoration to prevent decay to the timbers.

Conservatories/porches	
Repair category	N/A
Notes	Not applicable.

Communal areas	
Repair category	N/A
Notes	Not applicable.

Garages and permanent outbuildings	
Repair category	N/A
Notes	Not applicable.

Outside areas and boundaries	
Repair category	2
Notes	Weathered and damaged masonry was noted to sections of the boundary walling. Repointing is required. Remedial works are required to the boundary walls. Trees were noted in close proximity to the subjects and will require regular and ongoing maintenance.

Ceilings	
Repair category	2
Notes	See dampness, rot or infestation section. Stained and damaged plasterwork was noted within the property and will require remedial works.

Internal walls	
Repair category	2
Notes	See dampness, rot or infestation section. Stained and damaged plasterwork was noted within the property and will require remedial works.

Floors including sub-floors	
Repair category	2
Notes	Creaky and uneven flooring was noted. No comment can be made on the condition of the floor boards below any fitted floor coverings. A precautionary check should be undertaken with any necessary remedial works carried out thereafter. No sub floor areas were inspected.

Internal joinery and kitchen fittings	
Repair category	2
Notes	The kitchen units would benefit from being overhauled and upgraded with a modern equivalent. Internal joinery is generally serviceable however some wear and tear items were noted to {kitchen fittings/internal doors/facings etc.} and future maintenance or upgrading should be anticipated.

Chimney breasts and fireplaces	
Repair category	2
Notes	The gas fire within the living room is dated and would benefit from being upgraded with a modern equivalent. It may be approaching the end of its working life cycle. No tests have been undertaken by this firm. It is assumed that the gas fire has been installed in accordance with the manufacturer's recommendations for fluing and ventilation and that this has been regularly checked and tested. All test documentation should be obtained and authenticated at the point of sale. In the absence of any such documentation, the appliance should be tested by a registered engineer prior to use.

Internal decorations		
Repair category	2	
Notes	The internal fabric within the property requires to be cosmetically overhauled. An asbestos survey has not been carried out to categorically confirm/deny the presence of any asbestos materials in any decorative coverings.	

Cellars	
Repair category	N/A
Notes	Not applicable.

Electricity	
Repair category	2
Notes	The electric system is dated in line with modern living requirements and we recommend the system is checked and upgraded where necessary by a qualified electrician. We recommend a precautionary check of the electrical system is advised by a qualified Electrician prior to purchase. A qualified Electrician can provide an up to date EICR Report which can provide recommendations on any necessary works required to the electrical system to ensure the system is in line with current regulations. The Institution of Engineering Technology recommends that inspections and testings are undertaken at least every five years and on a change of occupancy. It should be appreciated that only the most recently constructed or re-wired properties will have installations which fully comply with IET regulations. Only recently re-wired properties will fully comply with current regulations, as such aspects of the electrical system could be dated in line with current regulations. We recommend a qualified electrician carry out as inspection of the system prior to purchase who can provide qualified advice and any necessary recommendations towards the system.

Gas	
Repair category	1
Notes	In the interests of safety and in light of recent regulations it would be prudent to have all gas appliances checked by a Gas Safe registered contractor.

Water, plumbing and bathroom fittings		
Repair category	2	
Notes	Lead plumbing was noted within the property and we recommend all lead plumbing is upgraded with a modern equivalent. The sanitary arrangements would benefit from being overhauled with a modern equivalent.	
	We presume the sealants around the sanitary fittings are functional and no defects are present to the adjacent areas. A precautionary check of the areas below and adjacent to the sanitary fittings is always recommended prior to purchase as these areas are prone to leakage.	

Heating and hot water		
Repair category	2	
Notes	It is assumed that the central heating system has been properly installed, updated and maintained to meet with all current regulations and standards with particular regard to fluing and ventilation requirements. Service records should be obtained and checked. In the absence of service documentation further advice should be obtained from a qualified heating engineer to ascertain the condition, efficiency, and life expectancy of the system.	
	The central heating system has not been checked or tested in any way however some older style components were noted including {	

Drainage	
Repair category	1
Notes	All foul and surface water drainage is assumed to be to the main public sewer. The system was not tested. A precautionary check of the drainage system is always recommended
	prior to purchase. No tests were carried out by this firm.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	3
Chimney stacks	2
Roofing including roof space	3
Rainwater fittings	2
Main walls	2
Windows, external doors and joinery	2
External decorations	2
Conservatories/porches	N/A
Communal areas	N/A
Garages and permanent outbuildings	N/A
Outside areas and boundaries	2
Ceilings	2
Internal walls	2
Floors including sub-floors	2
Internal joinery and kitchen fittings	2
Chimney breasts and fireplaces	2
Internal decorations	2
Cellars	N/A
Electricity	2
Gas	1
Water, plumbing and bathroom fittings	2
Heating and hot water	2
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Wherea lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	or(s) is the living accommodation on? Ground and First Floor		loors	
2. Are there three steps or fewer to a main entrance door of the property?		X	No	
3. Is there a lift to the main entrance door of the property?	Yes		No	X
4. Are all door openings greater than 750mm?	Yes		No	X
5. Is there a toilet on the same level as the living room and kitchen?	Yes	X	No	
6. Is there a toilet on the same level as a bedroom?	Yes	X	No	
7. Are all rooms on the same level with no internal steps or stairs?	Yes		No	X
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes	X	No	

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

It appears the property has been altered to form the current internal layout and it is presumed all documentation and permissions have been obtained for all such works.

Rights of access, land ownership and maintenance liabilities around the periphery of the subjects should be confirmed by inspection of the title deeds.

Where areas of maintenance, defects or repairs have been identified within this report it is recommended that, prior to entering into any legally binding sale or purchase contract, further specialist's or contractor's advice and estimates should be obtained, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property.

It is assumed that there are no statutory, town planning, road proposals or environmental matters which are likely to have an adverse effect on the property.

The road and footpath adjoining the site are made up and are assumed to be adopted by the Local Authority.

Estimated reinstatement cost for insurance purposes

For Reinstatement Cost Assessment purposes, it is recommended that the subjects be insured for a sum of not less than £2,000,000 (Two Million Pounds Sterling).

This figure is the estimate of the cost of rebuilding the premises and bears no direct relationship to current market value.

Valuation and market comments

Having considered matters, taking account of our general observations on site, we are of the opinion that the Market Value of the subjects in their present condition and with the benefit of vacant possession may be fairly stated in the sum of £900,000 (Nine Hundred Thousand Pounds Sterling).

Signed	Graeme Haywood Electronically signed :- 11/03/2025 16:10
Report author	Graeme Haywood
Company name	J & E Shepherd Chartered Surveyors

Address	12 Atholl Crescent Edinburgh EH3 8HA
Date of report	17/01/2025



www.shepherd.co.uk

Property Address			
Address	2 East Savile Road, Edinburgh, EH16 5ND		
Seller's Name	Church of Scotland		
Date of Inspection	17/01/2025		
Property Details			
Property Type X House	Bungalow Purpose built maisonette Converted maisonette		
Purpose built flat	Converted flat Tenement flat Flat over non-residential use		
	Other (specify in General Remarks)		
Property Style Detached	X Semi detached Mid terrace End terrace		
Back to back	High rise block Low rise block Other (specify in General Remarks)		
Does the surveyor believe that the military, police?	property was built for the public sector, e. g. local authority,		
Flats/Maisonettes only Floor(s) on wh	nich located No. of floors in block Lift provided? Yes No		
i late, maiosinomos sim,	No. of units in block		
Approximate Year of Construction	1890		
Tenure			
X Absolute Ownership	Other		
Accommodation			
Number of Rooms 2 Living room	n(s) 5 Bedroom(s) 1 Kitchen(s)		
2 Bathroom(s	o WC(s) Other (Specify in General remarks)		
Gross Floor Area (excluding garage	es and outbuildings) 207 m² (Internal) m² (External)		
Residential Element (greater than 4	J70) [A] 165 [] INO		
Garage / Parking / Outbuildings			
Single garage Double gar	rage Parking space X No garage / garage space / parking space		
Available on site? Yes X	S No		
Permanent outbuildings:			
None.			

Construction
Walls Brick X Stone Concrete Timber frame Other (specify in General Remarks) Roof Tile Slate Asphalt Felt X Other (specify in General Remarks)
Special Risks
Has the property suffered structural movement?
f Yes, is this recent or progressive?
s there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in \square Yes $\stackrel{ }{\boxtimes}$ No he immediate vicinity?
f Yes to any of the above, provide details in General Remarks.
Service Connections
Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location on the supply in General Remarks
Drainage X Mains Private None Water X Mains Private None Electricity X Mains Private None Gas X Mains Private None Central Heating X Yes Partial None
Brief description of Central Heating and any non mains services:
Gas boiler serving steel panel radiators.
Site Site
Apparent legal issues to be verified by the conveyancer. Please provide a brief description in General Remarks.
Rights of way Shared drives / access Garage or other amenities on separate site Shared service connections
Ill-defined boundaries Agricultural land included with property Other (specify in General Remarks)
Location
Residential suburb X Residential within town / city Mixed residential / commercial Shared service connections I Solated rural property Other (specify in General Remarks)
Planning Issues
Has the property been extended / converted / altered? X Yes No f Yes provide details in General Remarks.
Roads
X Made up road Unmade road Partly completed new road Pedestrian access only Adopted Unadopted

General Remarks

At the time of inspection the property was in a dated condition with upgrading works required to both the internal and external fabric.

The roof is pitched and laid in slate incorporating flat roof sections and valley guttering.

It appears the property has suffered from previous movement evident to distortions to the internal and external fabric. Within the limitations of a single survey and for the purposes of this valuation this appears longstanding and non-progressive in nature.

Due to the age and style of construction ongoing maintenance and upgrading works should be anticipated to the external fabric in particular to the chimneys, roof, rainwater fittings, main walls and site boundaries. Remedial works are required.

It appears the property has been altered to form the current internal layout and it is presumed all documentation and permissions have been obtained for all such works.

Rights of access, land ownership and maintenance liabilities around the periphery of the subjects should be confirmed by inspection of the title deeds.

Where areas of maintenance, defects or repairs have been identified within this report it is recommended that, prior to entering into any legally binding sale or purchase contract, further specialist's or contractor's advice and estimates should be obtained, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property.

It is assumed that there are no statutory, town planning, road proposals or environmental matters which are likely to have an adverse effect on the property.

The road and footpath adjoining the site are made up and are assumed to be adopted by the Local Authority.

_		40.0			
Ess	en	tıal	Re	nai	ıre
	\mathbf{c}_{11}	шы			1

Moisture meter readings were recorded within the property in particular to the rear outshot and around the cupola. Remedial works are required.
Evidence of water ingress was noted around the cupola and above the staircase. Cracked slates were noted. Flat roof coverings have a
limited life and will require regular and ongoing maintenance with a higher than average maintenance cost. We recommend a precautionary
check of the roof decks, pertinents and void areas are carried out by a qualified roofing contractor prior to purchase.

Estimated cost of essential repairs		
Retention recommended?	Yes X No	
Retention amount		

Comment on Mortgageability

The property forms suitable security for mortgage purposes subject to the specific lending criteria of any	mortgage provider.
--	--------------------

Valuation

900,000 Market value in present condition £ £ Market value on completion of essential repairs 2,000,000 Insurance reinstatement value (to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)

Is a reinspection necessary?

Page 3 of 4

Yes X No

Declaration

Signed Graeme Haywood

Electronically signed :- 11/03/2025 16:10

Surveyor's name Graeme Haywood
Professional qualifications MA (Hons), MRICS

Company name J & E Shepherd Chartered Surveyors
Address 12 Atholl Crescent, Edinburgh, EH3 8HA

Telephone 0131 225 1234

Email Address edinburghadminresi@shepherd.co.uk

Date of Inspection 17/01/2025



Energy Performance Certificate



Energy Performance Certificate (EPC)

Dwellings

Scotland

2 EAST SAVILE ROAD, MAYFIELD, EDINBURGH, EH16 5ND

Dwelling type: Semi-detached house
Date of assessment: 17 January 2025
Date of certificate: 11 March 2025

Total floor area: 207 m²

Primary Energy Indicator: 364 kWh/m²/year

Reference number: 0110-2643-7290-2395-1515 **Type of assessment:** RdSAP, existing dwelling

Approved Organisation: Elmhurst

Main heating and fuel: Boiler and radiators, mains


gas

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£11,187	See your recommendations	
Over 3 years you could save*	£3,858	report for more information	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

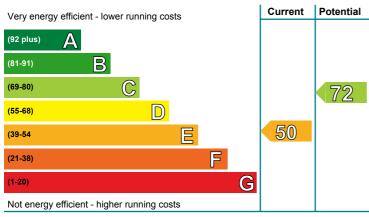


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band E (50)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

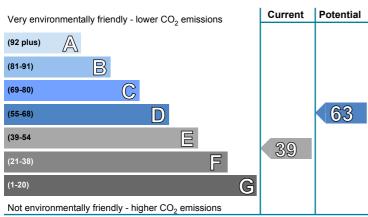

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO_2) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band E (39)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Internal or external wall insulation	£4,000 - £14,000	£1812.00
2 Floor insulation (suspended floor)	£800 - £1,200	£624.00
3 Condensing boiler	£2,200 - £3,000	£912.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone or limestone, as built, no insulation (assumed)	***	***
Roof	Pitched, no insulation (assumed)	***	***
Floor	Suspended, no insulation (assumed)	_	_
Windows	Single glazed	****	***
Main heating	Boiler and radiators, mains gas	****	★★★★ ☆
Main heating controls	Programmer, room thermostat and TRVs	***	★★★ ☆
Secondary heating	None	_	_
Hot water	From main system	****	★★★★ ☆
Lighting	Low energy lighting in all fixed outlets	****	****

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 64 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 13 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 5.4 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£10,212 over 3 years	£6,408 over 3 years	
Hot water	£531 over 3 years	£468 over 3 years	You could
Lighting	£444 over 3 years	£453 over 3 years	save £3,858
Totals	£11,187	£7,329	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.


Recommended measures		Indicative cost	Typical saving	Rating after improvement	
		Indicative cost	per year	Energy	Environment
1	Internal or external wall insulation	£4,000 - £14,000	£604	D 58	E 47
2	Floor insulation (suspended floor)	£800 - £1,200	£208	D 61	E 50
3	Replace boiler with new condensing boiler	£2,200 - £3,000	£304	D 65	D 55
4	Replace single glazed windows with low- E double glazed windows	£3,300 - £6,500	£170	D 67	D 58
5	Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£409	C 72	D 63

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

Micro CHP

Choosing the right improvement package





About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Internal or external wall insulation

Internal or external wall insulation involves adding a layer of insulation to either the inside or the outside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. External solid wall insulation is the application of an insulant and a weather-protective finish to the outside of the wall. This may improve the look of the home, particularly where existing brickwork or rendering is poor, and will provide long-lasting weather protection. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). It should be noted that a building warrant is required for the installation of external wall insulation. Planning permission may also be required and that building regulations apply to external insulation so it is best to check with your local authority on both issues.

2 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

3 Condensing boiler

A condensing boiler is capable of much higher efficiencies than other types of boiler, meaning it will burn less fuel to heat this property. This improvement is most appropriate when the existing central heating boiler needs repair or replacement, however there may be exceptional circumstances making this impractical. Condensing boilers need a drain for the condensate which limits their location; remember this when considering remodelling the room containing the existing boiler even if the latter is to be retained for the time being (for example a kitchen makeover). Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

4 Double glazed windows

Double glazing is the term given to a system where two panes of glass are made up into a sealed unit. Replacing existing single-glazed windows with double-glazed windows will improve comfort in the home by reducing draughts and cold spots near windows. Double-glazed windows may also reduce noise, improve security and combat problems with condensation. Building regulations apply to this work and planning permission may also be required, so it is best to check with your local authority on what standards need to be met. A building warrant is not required if the windows comply with the current requirements.

5 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit https://energysavingtrust.org.uk/energy-at-home for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	45,038	(9,596)	N/A	(9,006)
Water heating (kWh per year)	2,351			_

Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Mr. Graeme Haywood

Assessor membership number: EES/014225
Company name/trading name: J & E Shepherd
Address: L2 Atholl Crescent

Edinburgh EH3 8HA

Phone number: 0131 225 1234

Email address: edinburgh@shepherd.co.uk

Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT





Property Questionnaire



Property address	2 East Savile Road Edinburgh EH16 5ND
Seller(s)	Church of Scotland Housing and Loan Fund
Completion date of property guestionnaire	

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Length of ownership		
	How long have you owned the property?	28 years	
2.	Council tax		
	Which Council Tax band is your property	in? (Please tick one) □ F 図 G □ H	
3.	Parking		
	What are the arrangements for parking a (Please tick all that apply)	t your property?	
	• Garage		
	Allocated parking space		
	• Driveway		
	Shared parking		
	On street	\boxtimes	
	Resident permit	\boxtimes	
	Metered parking		
	Other (please specify):		
4.	Conservation area		
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?		✓ Yes☐ No☐ Don't know

5.	Listed buildings	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	☐ Yes ☑ No
6.	Alterations/additions/extensions	
a.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)? If you have answered yes, please describe below the changes which you have made:	☐ Yes ☑ No
	you have made.	
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	☐ Yes ☐ No
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.	
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property?	☐ Yes ☑ No
	If you have answered yes, please answer the three questions below:	
	(i) Were the replacements the same shape and type as the ones you replaced?	☐ Yes ☐ No
	(ii) Did this work involve any changes to the window or door openings?	☐ Yes ☐ No
	(iii) Please describe the changes made to the windows doors, or patio approximate dates when the work was completed):	doors (with
Please give any guarantees which you received for this work to your solicitor or agent.		olicitor or estate

7.	Central heating	
Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat a the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom). If you have answered yes or partial — what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air). gas fired If you have answered yes, please answer the three questions below		YesNoPartial
	(i) When was your central heating system or partial central heating new boiler and radiators installed Aug 2004	g system installed?
	(ii) Do you have a maintenance contract for the central heating system? If you have answered yes, please give details of the company with which you have a maintenance contract: Scottish Gas	⊠ Yes □ No
	(iii) When was your maintenance agreement last renewed? (Please and year).July 2024	provide the month
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	☐ Yes 図 No
9.	Issues that may have affected your property	
a.	Has there been any storm, flood, fire or other structural damage to your property while you have owned it? If you have answered yes, is the damage the subject of any outstanding insurance claim?	☐ Yes ☑ No ☐ Yes ☐ No
b.	Are you aware of the existence of asbestos in your property? If you have answered yes, please give details:	☐ Yes ⊠ No

10.	Services						
a. Pl	Please tick which services are connected to your property and give details of the supplier:						
	Services						
	Gas or liquid petroleum gas	yes	British Gas				
Water mains or private water supply Water mains or private water supply Mains							
	Electricity						
	Mains drainage						
	Telephone	No					
	Cable TV or satellite	no					
	Broadband	no					
b.	Is there a septic tank system a	at your property?		☐ Yes			
	If you have answered yes, plea	⊠ No					
	(iv) Do you have appropriat septic tank?	☐ Yes ☐ No ☐ Don't Know					
	(v) Do you have a maintena If you have answered yes, plea which you have a maintenance	☐ Yes ☐ No					

11.	Responsibilities for shared or common areas	
а.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?	✓ Yes☐ No☐ Don't Know
	If you have answered yes, please give details:	
b.	Mutual boundaries with adjoining property Is there a responsibility to contribute to repair and maintenance of	☐ Yes
D.	the roof, common stairwell or other common areas?	⊠ No
	If you have answered yes, please give details:	☐ Not applicable
C.	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	☐ Yes ☑ No
d.	Do you have the right to walk over any of your neighbours' property — for example to put out your rubbish bin or to maintain your boundaries?	☐ Yes ☑ No
	If you have answered yes, please give details:	
e.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?	☐ Yes ☑ No
	If you have answered yes, please give details:	
f.	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.) If you have answered yes, please give details:	☐ Yes ☑ No
	, i	
12.	Charges associated with your property	
a.	Is there a factor or property manager for your property? If you have answered yes, please provide the name and address,	☐ Yes ☑ No
	and give details of any deposit held and approximate charges:	

b.	Is there a common buildings insurance policy? If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges? Please give details of any other charges you have to pay on a regular be	☐ Yes ☐ No ☐ Don't Know ☐ Yes ☐ No ☐ Don't Know
<u> </u>	upkeep of common areas or repair works, for example to a residents' a maintenance or stair fund.	
13.	Specialist works	
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.	☐ Yes ☑ No
b.	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property? If you have answered yes, please give details:	☐ Yes ☑ No
C.	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work? If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. Guarantees are held by:	☐ Yes ☐ No

14.	Guarantees					
a.	Are there any guarantees or warranties for any of the following:					
		No	Yes	Don't know	With title deeds	Lost
(i)	Electrical work	\boxtimes				
(ii)	Roofing	\boxtimes				
(iii)	Central heating	\boxtimes				
(iv)	National House Building Council (NHBC)	\boxtimes				
(v)	Damp course	\boxtimes				
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	\boxtimes				
b.	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):					
C.	Are there any outstanding claims under any of the guarantees listed above?			s listed	☐ Yes ☐ No	
	If you have answered yes, please give details:					
15.	Boundaries					
	So far as you are aware, has any boundary of your property been moved in the last 10 years?			☐ Yes ⊠ No		
	If you have answered yes, please give deta	ils:			☐ Don't kn	ow

16.	Notices that affect your property			
	In the past three years have you ever received a notice:			
а.	advising that the owner of a neighbouring property has made a planning application?	☐ Yes ☑ No		
b.	that affects your property in some other way?	☐ Yes ☑ No		
C.	that requires you to do any maintenance, repairs or improvements to your property?	☐ Yes ☑ No		
	If you have answered yes to any of a-c above, please give the notices estate agent, including any notices which arrive at any time before the purchaser of your property.			
Declaration by the seller(s)/or other authorised body or person(s) I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.				
Sign	ature(s):			
Date	1 •			

shepherd.co.uk





Home Report

Valuation Report

Executory Valuation

Tax Valuations

Separation Valuation

Private Sale Valuation

New Build & Plot Valuation

Insurance Reinstatement Valuation

Portfolio Valuation

Rental Valuation

Drive By & Desktop Valuation

Energy Performance Certificate (EPC)

Level Two Survey & Valuation Report

Level Two Condition Report

Expert Witness Report





Commercial Valuation

Commercial Agency

Acquisitions Consultancy

Commercial Lease Advisory

Rent Reviews

Asset Management

Development Appraisals & Consultancy

Auctions

Property Management

Professional Services

Licensed Trade & Leisure

Expert Witness Report

Rating

Property Investment

Public Sector



PROPERTY & CONSTRUCTION CONSULTANTS



Quantity Surveying

Building Surveying

Project Management

Dispute Resolution Support Services

Principal Designer

Clerk of Works

Commercial EPC

Health & Safety Management

Employer's Agent

Energy Consultancy

Housing Partnerships

Housing Consultancy

Development Monitoring

Mediation Services

Aberdeen

△▲△ 01224 202800

Ayr △ △ 01292 267987

Bearsden △▲ 0141 611 1500

Belfast

▲ 02890 912975

Birmingham

▲ 0121 270 2266

Coatbridge

△▲ 01236 436561

Cumbernauld △ △ 01236 780000 Dalkeith

△ △ 0131 663 2780

Dumbarton

△ ▲ 01389 731682

Dumfries

△▲△ 01387 264333

Dundee

△▲ 01382 200454

△ 01382 220699

Dunfermline △▲ 01383 722337 △ 01383 731841

East Kilbride

△▲ 01355 229317

Edinburgh

△ 0131 557 9300

Elain

△ ▲ 01343 553939

Falkirk △△ 01324 635 999

Fraserburgh

△ ▲ 01346 517456

Galashiels

△△ 01896 750150

Glasgow

△△△ 0141 331 2807

Glasgow South △ ▲ 0141 649 8020 **Glasgow West End** △ ▲ 0141 353 2080

Greenock △▲01475 730717

Hamilton

△▲01698 891400

Inverness △△△01463 712239

Kilmarnock △△01563 520318

Kirkcaldy △ △ 01592 205442

Lanark △△01555 663058 Leeds

△ 0113 322 5069

Livingston △▲ 01<u>506 41677</u>7

London

▲△ 02033 761 236

Montrose △△ 01674 676768

Musselburgh △ △ 0131 653 3456

Oban

△▲ 01631 707 800

Paisley △△ 0141 889 8334

Perth

△△ 01738 638188 △ 01738 631631

Peterhead △△ 01779 470766

St Andrews

△△ 01334 477773 △ 01334 476469

Saltcoats △ △ 01294 464228

Stirling

△△ 01786 450438 △ 01786 474476